



**US Army Corps  
of Engineers**

Construction Engineering  
Research Laboratory

USA-CERL TECHNICAL REPORT M-87/13, VOL. II

September 1987

Roofing Maintenance Management System

---

# Membrane and Flashing Condition Indexes for Built-Up Roofs

## Volume II: Inspection and Distress Manual

by  
Mohamed Y. Shahin  
David M. Bailey  
Donald E. Brotherson

Because no systematic procedure exists to determine priorities and select repair strategies for low-slope roofs, the U.S. Army Construction Engineering Research Laboratory (USA-CERL) is developing a roof maintenance management system that will provide a practical decisionmaking procedure to identify cost-effective repairs.

As part of the system for built-up roofs, this volume presents the standardized information needed to conduct the visual inspection survey, including names, descriptions, severity levels, measurement criteria, causes, and photographs of membrane and flashing distresses. Procedures for distress density calculations are also provided. Roof inspectors can use this information to objectively determine the indexes that reflect the (1) ability of the membrane and flashing to perform their functions, (2) needed level of maintenance, and (3) waterproof integrity.

Volume I describes the development and verification of the indexes.

Approved for public release; distribution is unlimited.

**The contents of this report are not to be used for advertising, publication, or promotional purposes. Citation of trade names does not constitute an official indorsement or approval of the use of such commercial products. The findings of this report are not to be construed as an official Department of the Army position, unless so designated by other authorized documents.**

***DESTROY THIS REPORT WHEN IT IS NO LONGER NEEDED***

***DO NOT RETURN IT TO THE ORIGINATOR***

**REPORT DOCUMENTATION PAGE**

Form Approved  
OMB No 0704 0188  
Exp Date Jun 30 1986

1a REPORT SECURITY CLASSIFICATION Unclassified			1b RESTRICTIVE MARKINGS		
2a SECURITY CLASSIFICATION AUTHORITY			3 DISTRIBUTION / AVAILABILITY OF REPORT Approved for public release; distribution is unlimited		
2b DECLASSIFICATION / DOWNGRADING SCHEDULE					
4 PERFORMING ORGANIZATION REPORT NUMBER(S) USA-CERL TR M-87/13, Vol. II			5 MONITORING ORGANIZATION REPORT NUMBER(S)		
6a NAME OF PERFORMING ORGANIZATION U.S. Army Construction Engr Research Laboratory		6b OFFICE SYMBOL (if applicable)	7a NAME OF MONITORING ORGANIZATION		
6c ADDRESS (City, State, and ZIP Code) P.O. Box 4005 Champaign IL 61820-1305			7b ADDRESS (City, State, and ZIP Code)		
8a NAME OF FUNDING / SPONSORING ORGANIZATION 1. Northern Division (cont'd)		8b OFFICE SYMBOL (if applicable)	9 PROCUREMENT INSTRUMENT IDENTIFICATION NUMBER FADs N62472-85P05008, N62472-85WR00151, N62472-85WR00132		
8c ADDRESS (City, State, and ZIP Code) 1. Philadelphia Naval Base Philadelphia PA 19112-5094 2. 20 Massachusetts Ave., N.W. (cont'd)			10. SOURCE OF FUNDING NUMBERS		
	PROGRAM ELEMENT NO.	PROJECT NO.	TASK NO.	WORK UNIT ACCESSION NO.	
	4A162731	AT41	C	044	
11 TITLE (Include Security Classification) Membrane and Flashing Condition Indexes for Built-Up Roofs, Volume II: Inspection and Distress Manual					
12 PERSONAL AUTHOR(S) Shahin, Mohamed Y.; Bailey, David M.; Brotherson, Donald E.					
13a TYPE OF REPORT final		13b TIME COVERED FROM _____ TO _____		14 DATE OF REPORT (Year, Month, Day) 1987, September	15 PAGE COUNT 98
16 SUPPLEMENTARY NOTATION Copies are available from the National Technical Information Service Springfield, VA 22161					
17 COSATI CODES			18 SUBJECT TERMS (Continue on reverse if necessary and identify by block number)		
FIELD	GROUP	SUB-GROUP			
13	13		management information system mainframe roofs		
			built-up roofs		
19 ABSTRACT (Continue on reverse if necessary and identify by block number) Because no systematic procedure exists to determine priorities and select repair strategies for low-slope roofs, the U.S. Army Construction Engineering Research Laboratory (USA-CERL) is developing a roof maintenance management system that will provide a practical decisionmaking procedure to identify cost-effective repairs.  As part of the system for built-up roofs, this volume presents the standardized information needed to conduct the visual inspection survey, including names, descriptions, severity levels, measurement criteria, causes and photographs of membrane and flashing distresses. Procedures for distress density calculations are also provided. Roof inspectors can use this information to objectively determine the indexes that reflect the (1) ability of the membrane and flashing to perform their functions, (2) needed level of maintenance, and (3) waterproof integrity.  Volume I describes the development and verification of the indexes.					
20 DISTRIBUTION / AVAILABILITY OF ABSTRACT <input type="checkbox"/> UNCLASSIFIED/UNLIMITED <input checked="" type="checkbox"/> SAME AS RPT <input type="checkbox"/> DTIC USERS			21 ABSTRACT SECURITY CLASSIFICATION Unclassified		
22a NAME OF RESPONSIBLE INDIVIDUAL Gloria Wienke			22b TELEPHONE (Include Area Code) (217) 352-6511 ext 353	22c OFFICE SYMBOL CECER-IMT-E	

Unclassified

Block 8a. (cont'd)

Naval Facilities Engineering Command (NORTHNAVFACENGCOM)

2. OCE

Block 8c. (cont'd)

Washington, DC 20314-1000

Unclassified

## FOREWORD

This project was funded by the Northern Division Naval Facilities Engineering Command (NORTHNAVFACENGCOM), U.S. Naval Base, Philadelphia, PA, under Funding Authorization Documents N62472-85P05008, N62472-85WR00151, and N62472-85WR00132. The U.S. Navy Technical Monitor was Mr. Tom Wallace. Funds were also provided by the Assistant Chief of Engineers, Office of Chief of Engineers (OCE), under Project 4A162731AT41, "Military Facilities Engineer Technology"; Task C, "Operations/Management/Repair"; Work Unit 044, "Roofing Maintenance Management System." The U.S. Army Technical Monitor was Mr. Chester Kirk, DAEN-ZCF-B.

The work was performed by the Engineering and Materials (EM) Division, U.S. Army Construction Engineering Research Laboratory (USA-CERL) in cooperation with the U.S. Army Cold Regions Research and Engineering Laboratory (CRREL) and the U.S. Army Facilities Engineering Support Agency (FESA). Dr. R. Quattrone is Chief of USA-CERL-EM. The Technical Editor was Gloria J. Wienke, Information Management Office.

Mr. Donald Brotherson is a member of the Small Homes Council-Building Research Council, University of Illinois.

Special acknowledgement is due to contractors Mr. John Bradford and Mr. Dwight Jennings, who were key members of the development team and participated in all field testing and validation efforts. The assistance of the following individuals is acknowledged and appreciated: Mr. Robert Alumbaugh, Navy Civil Engineering Laboratory (NCEL); Mr. Mark de Ogburn, SOUTHNAVFACENGCOM; Mr. Dennis Firman, Air Force Engineering and Services Center (AFESC); Mr. Ed Humm, NCEL; Mr. Al Knehans, FESA; Mr. Myer Rosenfield, USA-CERL; and Mr. Wayne Tobiasson, CRREL.

COL Norman C. Hintz is Commander and Director of USA-CERL, and Dr. L. R. Shaffer is Technical Director.

# CONTENTS

	Page
DD FORM 1473	1
FOREWORD	3
LIST OF FIGURES	5
<b>1 INTRODUCTION</b> .....	<b>7</b>
Background .....	7
Objective .....	7
Approach .....	7
Using the Manual .....	8
<b>2 PROCEDURES FOR ROOF INSPECTION AND CALCULATION OF INDEXES</b> .....	<b>9</b>
Introduction .....	9
Roof Sections .....	9
Roof Plans .....	9
Inspection Procedure .....	12
Inspection Guidelines .....	14
Calculating the Indexes .....	18
<b>3 FLASHING DISTRESSES</b> .....	<b>23</b>
Index .....	23
Base Flashing .....	24
Metal Cap Flashing .....	30
Embedded Edge Metal .....	36
Flashed Penetrations .....	41
Pitch Pans .....	46
Interior Drains and Roof Level Scuppers .....	50
<b>4 MEMBRANE DISTRESSES</b> .....	<b>53</b>
Index .....	53
Blisters .....	54
Ridges .....	57
Splits .....	60
Holes .....	62
Surface Deterioration .....	63
Slippage .....	68
Patching .....	70
Debris and Vegetation .....	73
Improper Equipment Supports .....	76
Ponding .....	80
<b>APPENDIX A: Deduct Value Curves</b>	<b>83</b>
<b>APPENDIX B: Inspection and Rating Sheets</b>	<b>93</b>
<b>DISTRIBUTION</b>	

## LIST OF FIGURES

Number		Page
1	Membrane and Flashing Condition Indexes (MCI and FCI) and Ratings	8
2	Roof Inspection Worksheet	10
3	Legend to be Used on Roof Section Plans	11
4	Completed Roof Inspection Worksheet	13
5	Check Height of Base Flashing Above Deck	15
6	Check Base Flashing Height by Running Fingers Behind Counterflashing	15
7	Sweep Gravel Back From Embedded Edge Metal to Expose Joints	16
8	Tear in Stripping Felts Exposed by Sweeping Gravel Away at Joints	16
9	Roof Drain Clogged by Debris	17
10	Removing Debris Frees the Drain	17
11	Scupper Opening is too Small and Easily Clogged. Report in the "Remarks" Section of the Roof Inspection Worksheet.	19
12	Metal Curb Around Scuttle is Corroded and Needs Paint. Report in the "Remarks" Section.	19
13	Steps for Determining Roof Membrane Condition Rating	20
14	Roof Section Rating Form	21

**MEMBRANE AND FLASHING CONDITION  
INDEXES FOR BUILT-UP ROOFS  
VOLUME II: INSPECTION AND  
DISTRESS MANUAL**

**1 INTRODUCTION**

**Background**

Each of the U.S. armed services branches has a very large inventory of low-slope roofs. Roof repairs and reconstruction work are steadily increasing as the roofs approach the end of their service lives, making it increasingly important to better manage maintenance funds. To ensure the optimum use of these funds, the U.S. Army Construction Engineering Research Laboratory (USA-CERL) is developing a roofing maintenance management system for low-slope roofs. This work is being performed with the coordination and assistance of the U.S. Army Cold Regions Research and Engineering Laboratory (CRREL) and the U.S. Army Facilities Engineering Support Agency (FESA).

The system will be developed initially for built-up roofs and will include other roofing systems in the future. The system will be based on a roof condition evaluation procedure which includes a visual inspection survey and nondestructive testing of the roof insulation. The visual inspection will provide a membrane condition index (MCI) and flashing condition index (FCI) which are numerical indicators that reflect the condition of each component in terms of its ability to perform its function, needed level of maintenance and repair, and waterproof integrity.

The two condition indexes are calculated based on the type, severity, and density of distress as determined from the visual roof inspection. To obtain repeatable and meaningful condition index values, distress identification and measurement must be standardized.

**Objective**

The objective of this work effort was to develop a roof condition index procedure for built-up roofs determined from a visual inspection. This volume provides roof inspectors with a standardized reference for distress identification for both the membrane and flashing. The distress information is to be used in conjunction with the procedures presented in Chapter 2 to determine the MCI and FCI.

**Approach**

The existing U.S. Air Force roof condition index (RCI) procedure<sup>1</sup> was modified to improve its accuracy, reduce field effort, and increase its usefulness. The modifications and improvements were field tested and revised based on results obtained at seven military installations located in different climates. Guidelines for performing roof inspections and procedures for computing the MCI and FCI were developed.

---

<sup>1</sup>*Built-Up Roof Management Programs*, Air Force Manual, AFM 91-36, 3 September 1980.

## Using the Manual

Chapter 2 contains the inspection procedures. Distresses for the flashing and membrane are presented in Chapters 3 and 4, respectively. Names, descriptions, severity levels, photographs, measurement criteria, and causes are presented for each distress.

It is very important that the inspector be able to identify all distress types and their severity levels and specific defects. The inspector should study this manual and carry a copy for reference during the inspection.

The results of the roof inspection are to be used in conjunction with procedures in Chapter 2 to determine the MCI and FCI and their respective ratings (Figure 1). Deduct value curves are in Appendix A. A sample of the sheets to be used by the roof inspectors is provided in Appendix B.

It should be emphasized that inspectors must follow the distress descriptions in this manual to arrive at meaningful and consistent values for the condition indexes.

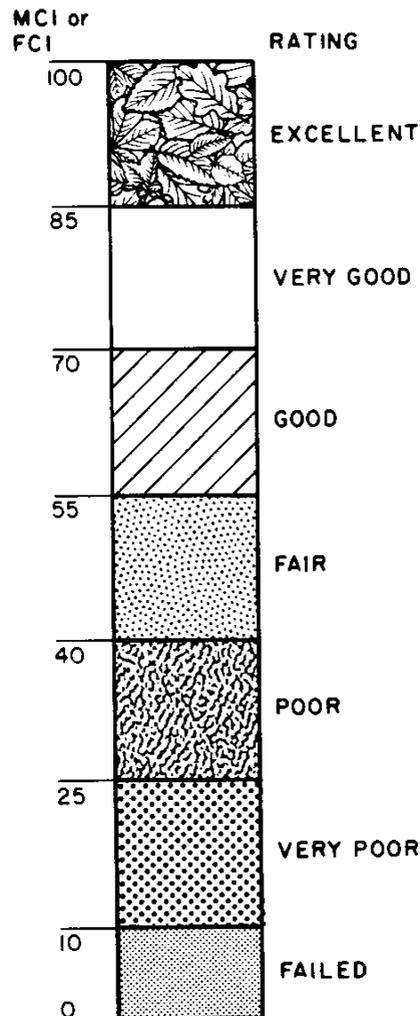


Figure 1. Membrane and Flashing Condition Indexes (MCI and FCI) and ratings.

## **2 PROCEDURES FOR ROOF INSPECTION AND CALCULATION OF INDEXES**

### **Introduction**

Determining the condition indexes requires measurement of all the existing roof membrane and flashing distresses. A thorough roof inspection must be made to determine the types, severity, specific defects, and amounts (density) of each distress present. This inspection must be carefully organized and planned to provide the necessary information for determining the membrane and flashing conditions.

This chapter presents the procedures for visually inspecting built-up roofs and computing the membrane and flashing condition indexes.

### **Roof Sections**

Dividing a building's roof into sections and rating each separately provides a better evaluation of the overall roof condition because (1) a roof section that is in poor condition would not detract from the condition index of a good roof section on the same building, and (2) a condition index indicating that replacement of the section is necessary would not signal replacement of the roof on the entire building.

A section is generally delineated by:

- expansion joints or area dividers
- different roof elevations
- areas of major repair or replacement
- areas that were built at different times
- areas having different roof systems, different amounts of roof traffic and/or rooftop equipment, or radically different occupancies below the roof
- areas having particularly sensitive occupancies below, such as computer centers, operating rooms or command centers.

Some judgment is necessary in cases where the roof is segmented into very small areas or if there are no identifiable delineations on large roofs. Small sections may be combined where practical. However, if areas have distinct differences in characteristics such as different structural systems, roof systems, or environments below the roof structure (i.e., canopies, freezers, unheated warehouses), they should be treated as individual sections. Large areas without delineations can be divided into sections with areas of 25,000 to 40,000 sq ft.

### **Roof Plans**

Each roof section should have a roof plan which is drawn to a scale (approximately 1" = 30' ) that fits on the Roof Inspection Worksheet (Figure 2). The plan should show all physical roof features, including perimeter conditions (roof edge, expansion joint, penthouse, etc.), rooftop equipment, projections through the roof, roof drains, walkways, sign supports, piping, etc. Standard symbols should be used to identify these items whenever possible (Figure 3).



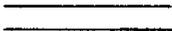
		H = HATCH E = EQUIPMENT P = PENTHOUSE S = SKYLIGHT SC = SOLAR COLLECTOR T = TRANSFORMER V = VENTILATOR
 or 		ANTENNA
		CORE SAMPLE
		VENT PIPE
		DRAIN OR DOWNSPOUT
		LADDER
 S		SCUPPER
 or 		CHIMNEY OR FLUE
		PITCH PAN
		FLASHED PIPE
		LIGHTNING ROD
		ROOF EDGE
		PARAPET WALL OR ADJACENT BLDG
		EXPANSION JOINT OR ROOF DIVIDER

Figure 3. Legend to be used on roof section plans.

## Inspection Procedure

### *Survey Team*

The roof inspection should be performed by a team of at least two people: an inspector and a recorder. The inspector surveys the roof, identifying distresses and determining severity levels, specific defects, and quantities. The recorder records the data on the Roof Inspection Worksheet and assists in measuring distress quantities when required. The recorder must also serve as the safety observer for the team.

### *Supplies*

The following supplies are required for performing the inspection:

- Inspection and Distress Manual
- Pencil and clipboard
- Roof Inspection Worksheets
- Small 3 in. pointing trowel (to scrape gravel)
- Can of spray paint
- Stiff bristle whisk broom
- Pocket knife
- 12-ft and 100-ft measuring tapes
- Large plastic bag (to collect rooftop debris)
- Satchel (for carrying tools and materials)

### *Survey Preparation*

The survey team should complete the general information section at the top of the Roof Inspection Worksheet (Figure 2) and gain access to the roof section. Contact the building superintendent or custodian for assistance. Develop or verify the roof plan before the survey begins. All penetrations, projections, and rooftop equipment should be shown and located correctly. Check plan dimensions against actual field dimensions.

### *Distress Survey*

Perform the distress survey using the following steps:

1. Inspect the perimeter flashing. Establish a starting point at one corner of the roof section. Walk the entire perimeter, examining the base flashing, embedded edge metal flashing, and metal cap flashing.

2. Identify all distresses and specific defects according to the distress manual. Mark each medium and high severity distress with spray paint.\* Enter each identified distress by type, severity level, specific defect (specific defects are listed numerically for each distress [see Chapters 3 and 4]), and quantity on the Roof Inspection Worksheet. Note the location of each distress on the roof plan using an identification number (Figure 4). Determine the distress quantities using the measurement criteria described in Chapters 3 and 4.

3. After inspecting the perimeter, work across the roof area inspecting all other flashings: curbed penetrations, flashed penetrations, pitch pans, drains, etc. Record data as in step 2.

---

\*To be used by maintenance personnel for locating necessary work.

ROOF INSPECTION WORKSHEET		INSTALLATION <u>FT. JONES</u>				
BUILDING <u>68</u>	PER. FLASHING <u>527</u> FT	DATE <u>19 MAY 87</u>				
SECTION <u>G</u>	CURB FLASHING <u>36</u> FT	NAME <u>R. SMITH</u>				
BF - BASE FLASH MC - METAL CAP EM - EMBEDDED MET FP - FLASHED PEN PP - PITCH PANS DR - DRAIN & SCUPPER		DISTRESS TYPE BL - BLISTERS RG - RIDGES SP - SPLITS HL - HOLES SR - SURF DET				
		SL - SLIPPAGE PA - PATCHING DV - DEBRIS & VEG EQ - EQ SUPPORTS PD - PONDING				
		I D E N T N O	D I S T R E S S	S E V E R I T Y	D E F E C T	Q U A N T I T Y
		1	BF	L	1	130
		2	BF	L	1	123
		3	MC	H	2	10
		4	BF	M	2	31
		5	MC	L	2	5
		6	DR	L	1	1
		7	PP	H	4	1
		8	FP	H	2	1
		9	FP	H	4	1
		10	DR	H	3	1
		11	BL	L	1	4
		12	PA	M	1	10
		13	PA	M	1	24
		14	SP	H	1	123
		15	PD	L	1	20
		16	SR	M	1	400
		17	BL	M	1	6
		18	BL	L	1	12
		19	HL	H	1	1
		20	EQ	M	1	3
		21	SR	L	4	8
		22	DV	M	3	30
		23	SR	M	1	120
SCALE: <u>1" = 30'</u>		 NORTH				

Figure 4. Completed roof inspection worksheet. (This form has been reduced in size.)

4. Inspect the roof membrane. Establish a starting point at one corner of the roof section. Using 10- to 15-ft wide strips, sweep back and forth across the roof section surveying the entire membrane. Record data as in step 2.

5. Complete the "Remarks" section on the back of the Roof Inspection Worksheet.

It is imperative to use the distress definitions listed in this distress manual when performing roof inspections. If these definitions are not followed, accurate indexes cannot be determined. Use a second Roof Inspection Worksheet if the first one becomes filled.

### **Inspection Guidelines**

The guidelines below should be followed when performing the visual inspection and distress survey.

#### *Base Flashing*

Measure height of top termination of base flashing above the roof surface (Figure 5). To establish the height, run fingers up behind the counterflashing. If the base flashing height cannot be determined, assume it is adequate (Figure 6).

#### *Metal Cap Flashing*

Check for looseness of metal cap flashing by attempting to lift it by hand at several locations.

#### *Embedded Edge Metal*

Determine the total number of joints by dividing the total length of embedded edge metal flashing by the length of the edge metal sections (normally 10 ft). Inspect every fourth joint for splits in the stripping felts, removing any loose gravel or dirt from the joint using the small whisk broom and pointing trowel (Figure 7). Determine the number of inspected joints that are high severity (have splits in the stripping felts [Figure 8]) and multiply by 4 to get the total number of high severity joints (one joint equals 1 ft). All other joints are considered medium severity. Multiply the number of inspected joints not counted as high severity by 4 to obtain the total number of medium severity joints. Check that the embedded edge metal flashing is secure by attempting to lift the outside edge.

#### *Flashed Penetrations*

Check the height of the flashing sleeve above the roof surface. Use a whisk broom and trowel to examine stripping felts.

#### *Interior Drains and Roof Level Scuppers*

Check all drains and scuppers and remove debris whenever possible (Figures 9 and 10). When inspecting drains, make sure the clamping ring is tight. Stripping felts around scuppers should be inspected for holes at corners.



Figure 5. Check height of base flashing above deck.



Figure 6. Check base flashing height by running fingers behind counterflashing.



Figure 7. Sweep gravel back from embedded edge metal to expose joints.



Figure 8. Tear in stripping felts exposed by sweeping gravel away at joints.

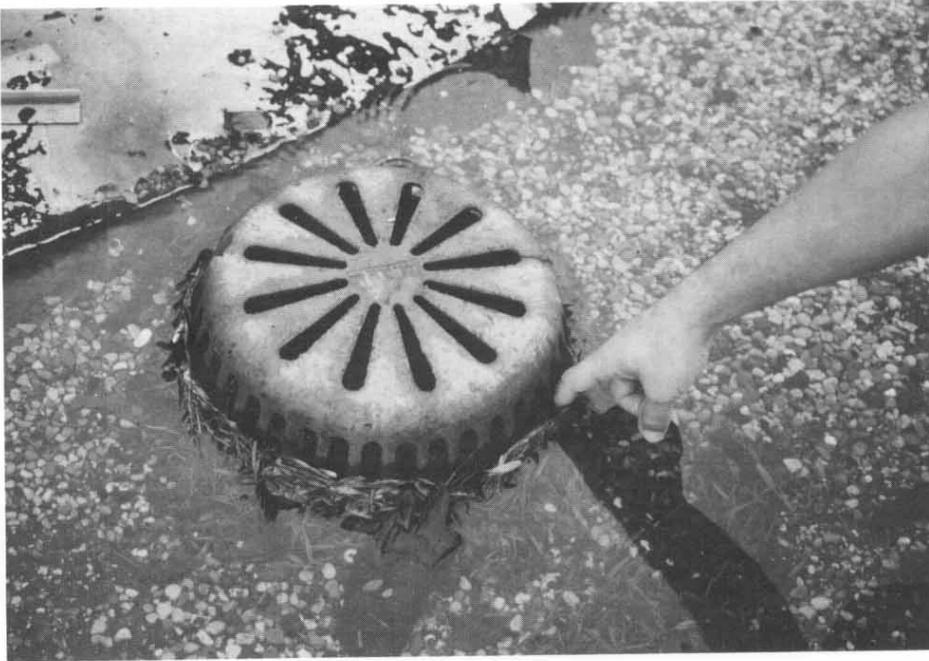


Figure 9. Roof drain clogged by debris.

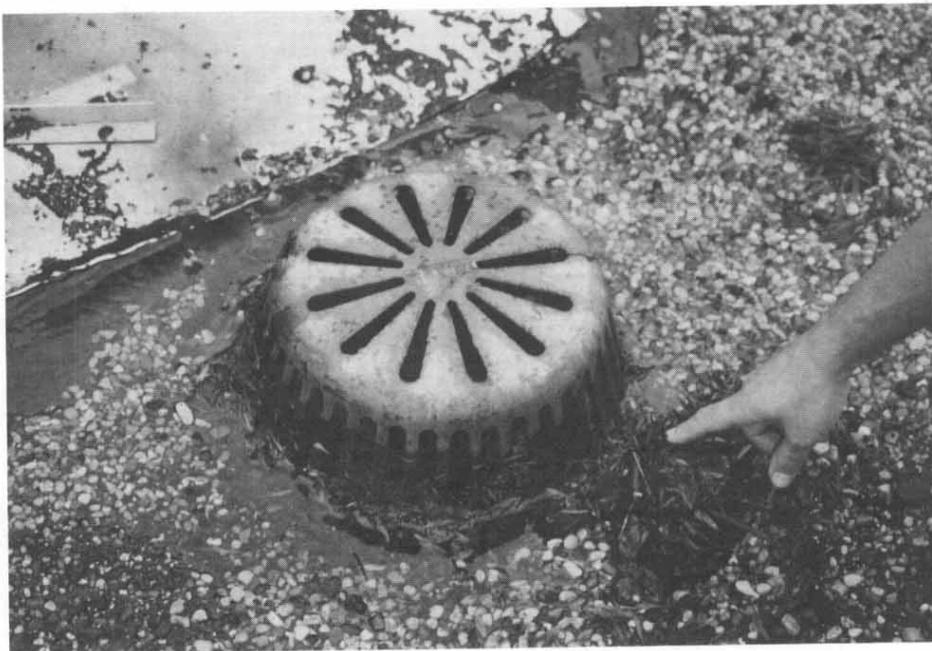


Figure 10. Removing debris frees the drain.

## *Membrane*

Membrane inspection requires surveying the entire roof area. However, when large areas of a particular distress and severity level are present (especially on large roofs), the representative sampling technique can be used. Select a portion of the roof (approximately 1000 sq ft) which appears to be typical of the entire roof area. Measure the quantity of distress in the sample area and by extrapolation, calculate the quantity for the entire roof area. An area that differs greatly from the majority of the roof should be surveyed separately.

## *General*

The following is a list of general guidelines for the roof inspection:

- Be careful not to damage the roof. Do not step on blisters, kick base flashing or step on edge flashing.
- Note existing problems that are not included in the lists of flashing and membrane distresses in the "remarks" section on the back of the worksheet. Figures 11 and 12 show examples of these problems. Walk the outside of the building and look for water stains, efflorescence, missing mortar, spalled brick, and gutter and drainage problems.
- Walk the interior of the building and examine the ceiling below the roof deck for water marks. Note rusting or other signs of water penetration or leaks in the "remarks" section on the back of the worksheet.
- If there is snow or a large area of ponding on the roof, postpone the inspection until the roof is clear.
- Wherever possible, use a measuring tape to determine roofing distress quantities. Estimating is acceptable when necessary; however, the rating accuracy will be only as good as the estimating accuracy. Pacing to find lengths, or some other quantifying estimating method, is preferable to an "eyeball" estimate.
- If more than one severity level of a distress exists in a localized area, count the entire area at the highest severity level.

## **Calculating the Indexes**

Once the condition survey is completed, determine the FCI and MCI for the roof section. Calculating the condition indexes is a simple procedure which involves five steps (Figure 13).

1. For each combination of distress and severity level, transfer the quantities from the Roof Inspection Worksheet to the Roof Section Rating Form (Figure 14).
2. Total the quantities for each combination, calculate their corresponding densities, and determine the deduct values from the deduct value curves (Appendix A) for each distress type and severity.

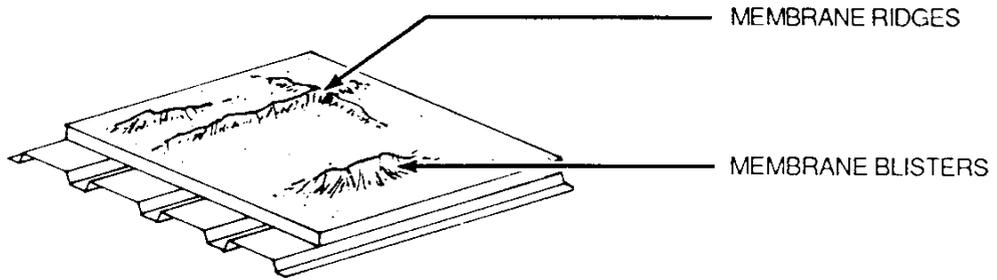


**Figure 11. Scupper opening is too small and easily clogged. Report in the "Remarks" section on the back of the Roof Inspection Worksheet.**


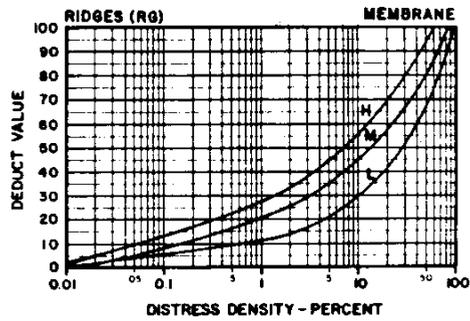


**Figure 12. Metal curb around scuttle is corroded and needs paint. Report in the "Remarks" section.**

STEP 1. INSPECT ROOF. DETERMINE DISTRESS TYPES AND SEVERITY LEVELS;  
DETERMINE QUANTITIES AND CALCULATE DENSITIES.





STEP 2. DETERMINE DEDUCT VALUES.

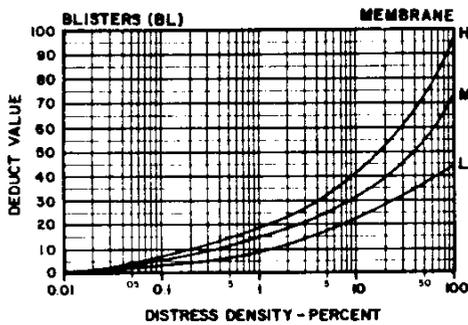

STEP 5. DETERMINE MEMBRANE  
CONDITION RATING.

STEP 3. COMPUTE CORRECTED DEDUCT VALUE.

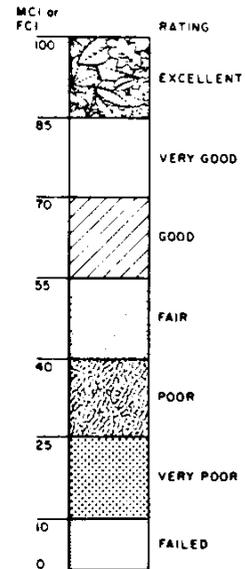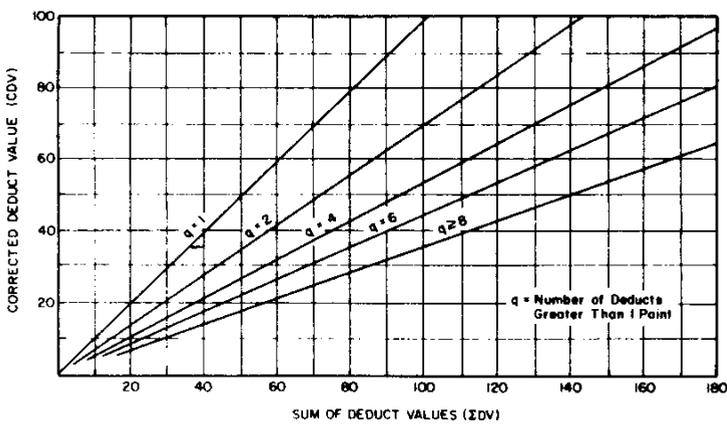

STEP 4. COMPUTE MEMBRANE CONDITION INDEX (MCI) = 100 - CDV

Figure 13. Steps for determining roof membrane condition rating.

ROOF SECTION RATING FORM											
BUILDING <u>68</u>			SECTION <u>6</u>			DATE <u>21 MAY 87</u>			CALC. BY <u>DB</u>		
PER. FLASHING <u>527</u> FT			FLASHING TOTAL <u>563</u> FT			AREA <u>16,800</u> SQFT			CHKD. BY <u>BD</u>		
FLASHING DISTRESS TYPE					MEMBRANE DISTRESS TYPE						
BF - BASE FLASH		DR - DRAIN & SCUPPER			BL - BLISTERS		SL - SLIPPAGE				
MC - METAL CAP					RG - RIDGES		PA - PATCHING				
EM - EMBEDDED MET					SP - SPLITS		DV - DEBRIS & VEG				
FP - FLASHED PEN					HL - HOLES		EQ - EQU SUPPORTS				
PP - PITCH PANS					SR - SURF DET		PD - PONDING				
TYPE	SEV	QUANTITIES	TOT.	DEN.	DV	TYPE	SEV	QUANTITIES	TOT.	DEN.	DV
BF	L	130+123	253	45	17	BL	L	4+12	16	.10	3
MC	H	10	10	1.8	13	PA	H	10+24	34	.20	7
BF	M	31	31	5.5	13	SP	H	123	123	.73	65
MC	L	5	5	.89	2	PD	L	20	20	.12	3
DR	L	1	1	.18	1	SR	H	400+120	520	3.1	14
PP	H	1	1	.18	9	BL	H	6	6	.036	2
FP	H	1+1	2	.36	11	HL	H	1	1	.006	5
DR	H	1	1	.18	21	EQ	H	3	3	.018	3
						SR	L	8	8	.048	2
						DV	H	30	30	.18	2
CORRECTED DEDUCT VALUE (CDV)					<b>33</b>	CORRECTED DEDUCT VALUE (CDV)					<b>65</b>
FCI = 100 - CDV = <u>67</u>						MCI = 100 - CDV = <u>35</u>					
FLASHING RATING = <u>GOOD</u>						MEMBRANE RATING = <u>POOR</u>					

Figure 14. Roof section rating form. (This form has been reduced in size.)

3. For each component (flashing and membrane), list the individual deduct values in descending order and compute the sum of the deduct values ( $\Sigma DV$ ) and  $q$  (# of DV's > 1) as shown below. Determine the corresponding corrected deduct values (CDVs) from the Corrected Deduct Value Curves (Appendix A). The CDV of maximum value should be used to compute the condition index.

Flashing (distress data from Figure 14)

<u>DV</u>	<u><math>\Sigma DV</math></u>	<u>q</u>	<u>CDV</u>
21	21	1	21
17	38	2	24
13	51	3	28
13	64	4	32
11	75	5	33
9	84	6	33
2	86	7	32
1	87	7	31

Maximum  $CDV_{\text{flashing}} = 33$

Membrane (distress data from Figure 14)

<u>DV</u>	<u><math>\Sigma DV</math></u>	<u>q</u>	<u>CDV</u>
65	65	1	65
14	79	2	55
7	86	3	53
5	91	4	48
3	94	5	47
3	97	6	43
3	100	7	40
2	102	8	37
2	104	9	38
2	106	10	38

Maximum  $CDV_{\text{membrane}} = 65$

4. Compute the condition indexes using the following equations:

$$FCI = 100 - \text{Max. } CDV_{\text{flashing}} \quad [\text{Eq 1}]$$

$$MCI = 100 - \text{Max. } CDV_{\text{membrane}} \quad [\text{Eq 2}]$$

5. Determine the condition ratings from Figure 1.

**3 FLASHING DISTRESSES**

**Index**

<u>Distress</u>	<u>Page</u>
Base Flashing .....	24
Metal Cap Flashing .....	30
Embedded Edge Metal .....	36
Flashed Penetrations .....	41
Pitch Pans .....	46
Interior Drains and Roof Level Scuppers .....	50

## BASE FLASHING

**Description:** Base flashing is one or more plies of material which extend from the roof surface up onto a vertical or inclined surface providing a watertight termination of the membrane.

### Severity Levels:

**Low:** Any of the following conditions:

1. Loss of surfacing on mineral-surfaced sheets or other poor appearance (including patching) but no apparent deterioration of felts.
2. Top of base flashing is less than 6 in. above the roof surface.
3. Flashing has permanent repairs.



**Medium:** Any of the following conditions:

1. Slippage, wrinkling, blistering, or pulling of base flashing material.
2. Loss of surfacing with some deterioration of felts but no holes, splits, or tears.
3. Grease, solvent, or oil drippings on the base flashing but no deterioration of felts.
4. Flashing has temporary repairs.

**High:** Any of the following conditions:

1. Holes, splits, or tears in flashing caused by deterioration or physical damage.
2. Exposed gaps at the top of the base flashing which are not covered by counter-flashing or open side laps in the flashing which allow water to channel behind them.
3. Grease, solvent, or oil drippings on the base flashing with deterioration of the felts.

**Measurement:** Measure lineal feet of base flashing having the above conditions. Holes, open side laps, and seams count as 1 ft each. If an area of the base flashing is at medium severity and holes are closer than 6 in., count that entire length of distressed base flashing as high severity.

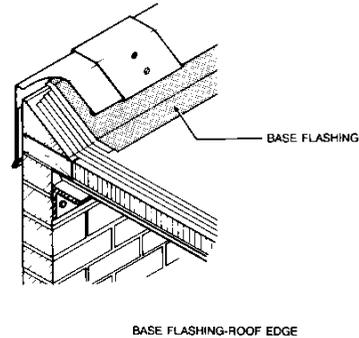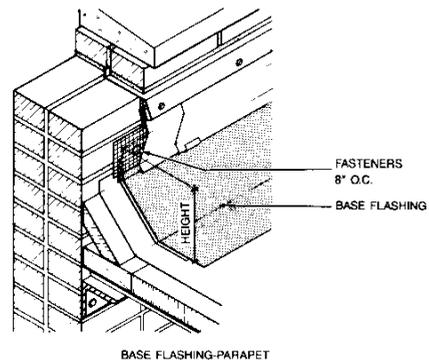

Base Flashing (BF)

**Density:**

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = length of base flashing defects (ft)

B = total length of flashed perimeter of roof section being rated (including flashings for penthouses, courtyards, and curbed projections)

Note: The problem density is calculated for each existing severity level.

**Causes:**

1. Flashing splits or tears can result from mechanical damage, material shrinkage, unattached membrane pulling the flashing, or differential movement between the wall and the deck.
2. Delamination and sliding result from weak or no attachment between the flashing plies or between the flashing and the substrate. This can result from any of the following conditions:
  - When first installed, the flashing plies were not firmly pressed into the bitumen to form a solid, continuous laminate.
  - No primer was used on the wall.
  - The wrong bitumen was used to attach the flashing plies to the wall.
  - The flashing cement was improper or of poor quality.
  - The hot-mopped bitumen was allowed to cool before the flashing plies were applied.
  - Fasteners were improper type or too few to hold flashing to substrate.



BF1 Base Flashing  
 <Low Severity>  
 Curb is not high enough--  
 6 in. minimum



BF2 Base Flashing  
 <Low Severity>  
 Surface looks poor but there are  
 no areas that are worn through



BF3 Base Flashing  
 <Low Severity>  
 Poor appearance of coating but coating  
 is not worn through. Also, counter-  
 flashing is displaced <High Severity>



BF4 Base Flashing  
 <Low Severity>  
 Mineral surfacing is worn but  
 surface is still intact

Base Flashing (BF)



**BF5** Base Flashing  
<Medium Severity>  
Surfacing is worn but hole is not all the way through the flashing



**BF6** Base Flashing  
<Medium Severity>  
Base flashing is pulled and not firmly bonded to the curb




**BF7** Base Flashing  
<Medium Severity>  
Flashing material has sagged




**BF8** Base Flashing  
<High Severity>  
Deteriorated flashing material; there are holes through all piles of the flashing


Base Flashing (BF)

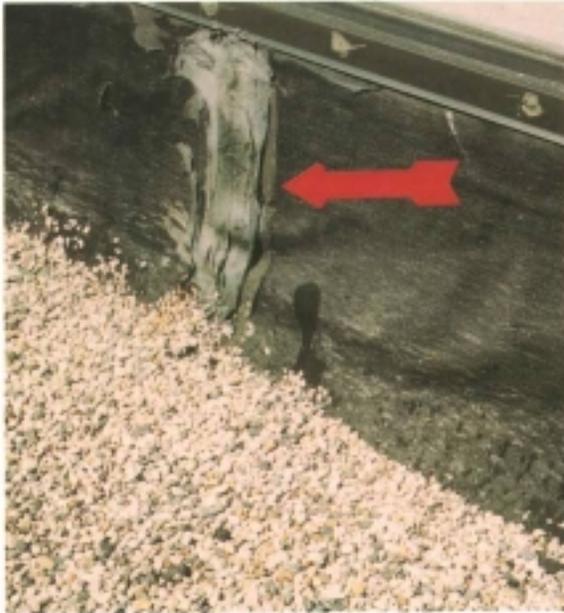

BF9 Base Flashing  
<High Severity>  
There is an open seam and the material has sagged

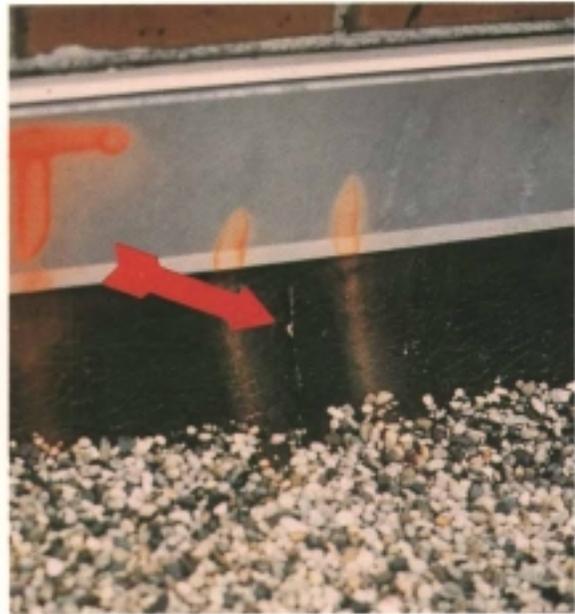

BF10 Base Flashing  
<High Severity>  
There is an open seam in the flashing

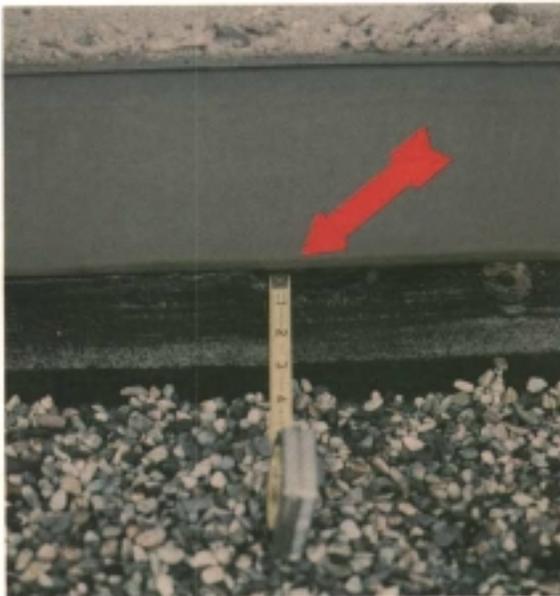

BF11 Base Flashing  
<High Severity>  
Flashing has sagged; top is open



BF12 Base Flashing  
<High Severity>  
There is a hole through the flashing material

Base Flashing (BF)



BF13 Base Flashing  
<High Severity>  
There is an open seam in the flashing



BF14 Base Flashing  
<High Severity>  
There is a hole in the flashing material

Base Flashing (BF)

## METAL CAP FLASHING






**Description:** Metal cap flashing includes counterflashing and any sheet metal coping cap which serves as part of the counterflashing or the cover over a detail such as a roof area divider, equipment curb, raised roof edge, or an expansion joint (including the rubber bellows of an expansion joint).

Counterflashing is the material, usually sheet metal, which protects the top termination of base flashing and sheds water away from it. Counterflashing should be free to expand and contract.

### Severity Levels:

**Low:** Any of the following conditions:

1. Loss of paint or protective coating or start of metal corrosion.
2. Metal coping cap is deformed and allows water to pond on the top.
3. Counterflashing is deformed but still performing its function.
4. Counterflashing has been sealed to the base flashing.

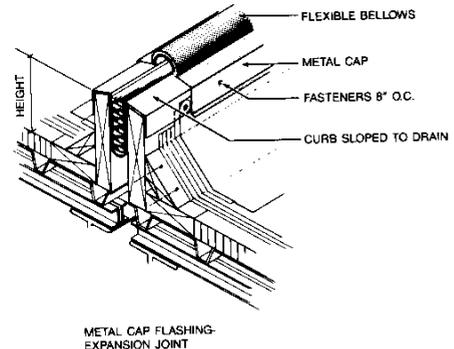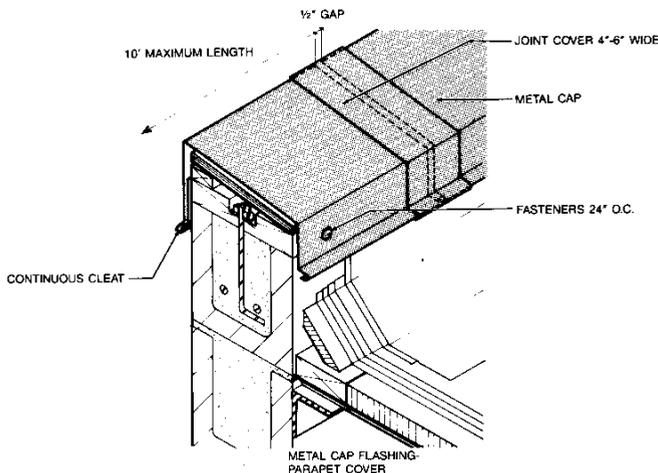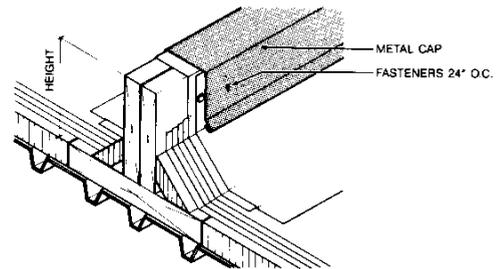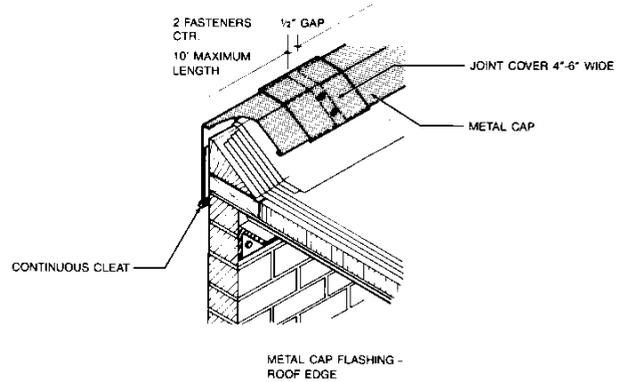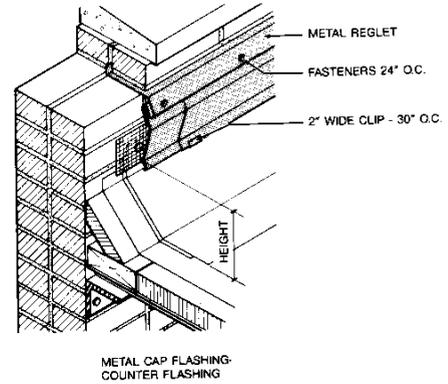

Metal Cap Flashing (MC)

**Medium:** Any of the following conditions:

1. Corrosion holes have occurred through the metal on a vertical surface.
2. Metal coping cap has loose fasteners, failure of soldered or sealed joints, open joints, or loss of attachment.
3. Sealant at reglet or top of counterflashing is missing or no longer functioning, allowing water to channel behind counterflashing.
4. Counterflashing is loose at the top, allowing water to channel behind it.
5. Counterflashing does not extend over top of base flashing.

**High:** Any of the following conditions:

1. Metal coping cap or counterflashing is missing or displaced from its original position.
2. Corrosion holes have occurred through the metal on a horizontal surface.
3. Metal coping cap has missing joint covers where joint covers were originally installed.

**Measurement:** Measure lineal feet of metal cap flashing having the above conditions. Individual defects (i.e., joints, holes) count as one foot minimum.

**Density:**


$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = length of metal cap flashing defects (ft)  
B = total length of flashed perimeter of roof section being rated (including flashings for penthouses, courtyards, and curbed projections)


**Note:** The problem density is calculated for each existing severity level.




**MC1 Metal Cap Flashing**  
 <Low Severity>  
 The metal has begun to corrode but no holes are evident

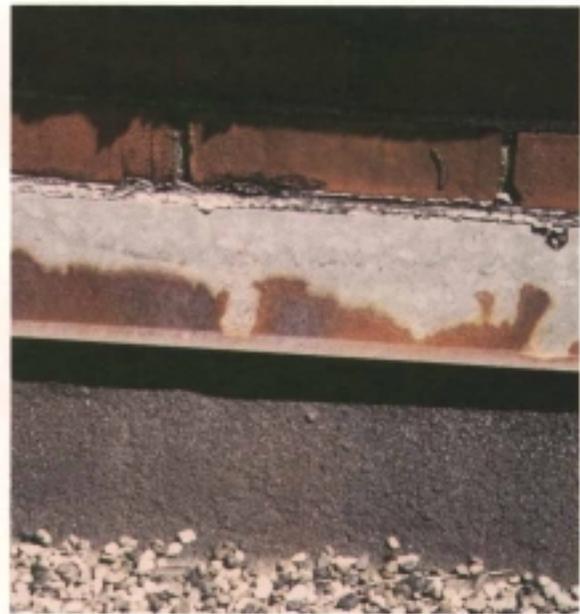

**MC2 Metal Cap Flashing**  
 <Low Severity>  
 The metal is bent but still functions; there is some corrosion

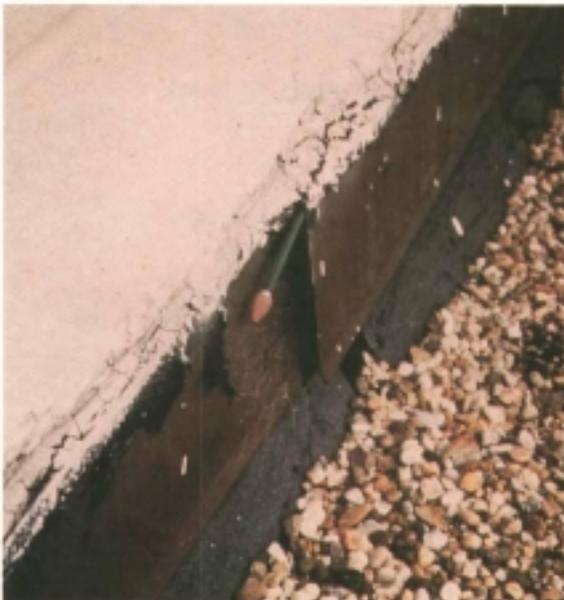

**MC3 Metal Cap Flashing**  
 <Low Severity>  
 The metal is bent but still is able to function

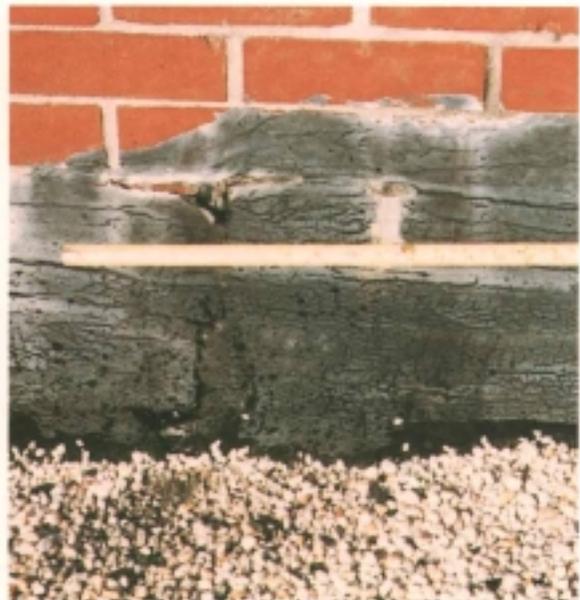

**MC4 Metal Cap Flashing**  
 <Low Severity>  
 The counterflashing has been sealed to the base flashing

**Metal Cap Flashing (MC)**



MC5 Metal Cap Flashing  
 <Low Severity>  
 Metal or accessories have been deformed or damaged



MC6 Metal Cap Flashing  
 <Low Severity>  
 Water can accumulate on top of the cap



MC7 Metal Cap Flashing  
 <Medium Severity>  
 The metal has been bent so that water can accumulate on the joint in the masonry



MC8 Metal Cap Flashing  
 <Medium Severity>  
 The top of the counterflashing holds water

Metal Cap Flashing (MC)



**MC9 Metal Cap Flashing**  
<Medium Severity>  
The top of the counterflashing is loose



**MC10 Metal Cap Flashing**  
<Medium Severity>  
Joint in cap has failed; caulking has not corrected the problem.  
Also, Base Flashing has holes  
<High Severity>



**MC11 Metal Cap Flashing**  
<Medium Severity>  
Neoprene cover at joint has failed



**MC12 Metal Cap Flashing**  
<High Severity>  
The metal counterflashing has fallen off of the wall

Metal Cap Flashing (MC)



MC13 Metal Cap Flashing  
 <High Severity>  
 The metal has corroded so that there are holes in the metal



MC14 Metal Cap Flashing  
 <High Severity>  
 Joint covers are missing



MC15 Metal Cap Flashing  
 <No Severity level--report in remarks>  
 The reglet has been cut into the top of the parapet wall; the caulking has failed



MC16 Metal Cap Flashing  
 <No Severity level--report in remarks> There is no cap flashing; water has penetrated the masonry and deterioration has occurred due to freeze-thaw action

Metal Cap Flashing (MC)

## EMBEDDED EDGE METAL

**Description:** Formed strip of metal at the roof edge which continues down the vertical part of the wall to form a fascia or drip. This stripped-in flashing provides a finished termination for the roofing membrane. A formed vertical projection (gravel stop) may be incorporated to prevent loose aggregate from rolling or washing off the roof. Exterior and interior gutters, which are embedded into the membrane, are considered as embedded edge metal. (An interior gutter is a built-in trough of metal or other material which collects water from the roof and carries it to a downspout.)

**Note:** A raised roof edge which is not stripped in, is rated as metal cap flashing and not as embedded edge metal.

### Severity Levels:

#### Low:

1. The entire length of embedded edge metal flashings is rated low severity as a minimum due to the maintenance problems associated with it.

#### Medium:

 Any of the following conditions:



1. The joints in embedded edge metal flashings are rated medium severity as a minimum due to the maintenance problems associated with them.
2. Nails under the stripping felts are backing out.
3. Corrosion of the metal.
4. Loose or lifted metal flange without deterioration of the stripping felts.
5. The entire length of interior gutter is rated medium severity as a minimum due to the maintenance problems and high potential for leak damage associated with its presence.

#### High:

 Any of the following conditions:

1. Stripping felts are missing or loose.
2. Splits in the stripping felts above the metal joints.
3. Holes have occurred through the metal.
4. Loose or lifted metal flange with deterioration of the stripping felts.
5. Holes or joint movement are present in the interior gutter.

**Measurement:** Measure lineal feet of embedded edge metal flashing having the above conditions. Each split above a joint is counted as one foot. As a method of sampling the joints, determine the total number of joints by dividing the total length of embedded edge metal flashing by the length of edge metal sections (normally 10 ft). Every fourth

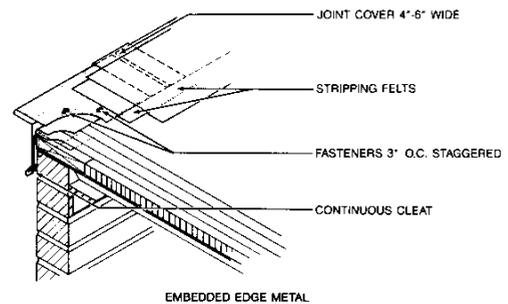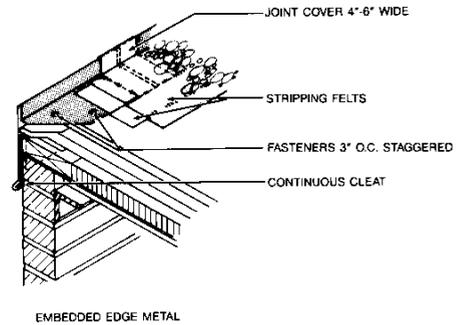

joint should be inspected for splits in the stripping felts. Count the number of inspected joints that are high severity and multiply by 4 to determine the total lineal feet of high severity joints. All other joints are rated medium severity. Multiply the number of inspected joints not rated high severity by 4 to determine the total lineal feet of medium severity joints.

**Density:**

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = length of embedded edge metal flashing defects (ft)

B = total length of flashed perimeter of roof section being rated (including flashings for penthouses, courtyards and curbed projections)


Note: The problem density is calculated for each existing severity level.

**Causes:**


1. Splits in the stripping felts and loose stripping felts are caused by:
  - Insufficient or improper nailing of the metal flange allowing it to move.
  - Insufficient or no priming of the metal flange (top and bottom) before installation. This prevents bonding of the bitumen to the metal.
  - The widely different expansion coefficients of the metal and bituminous components.
2. Exposed metal flanges can result from stripping felt deterioration or the flange may never have been stripped-in.
3. Loose or lifted metal edge is caused by insufficient fastening, rotting, or lack of a wood perimeter nailer.



EM1 Embedded Edge Metal  
 <Low Severity>  
 Tapered edge metal is raised but strip-in still presents a potential hazard

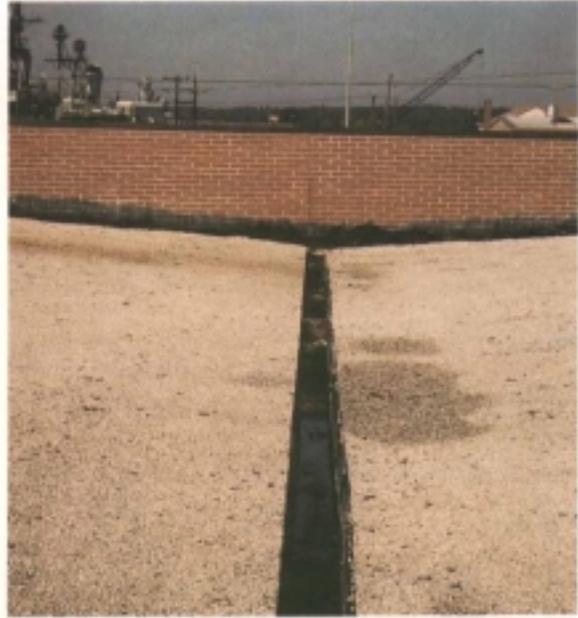

EM2 Embedded Edge Metal  
 <Medium Severity>  
 There are interior gutters

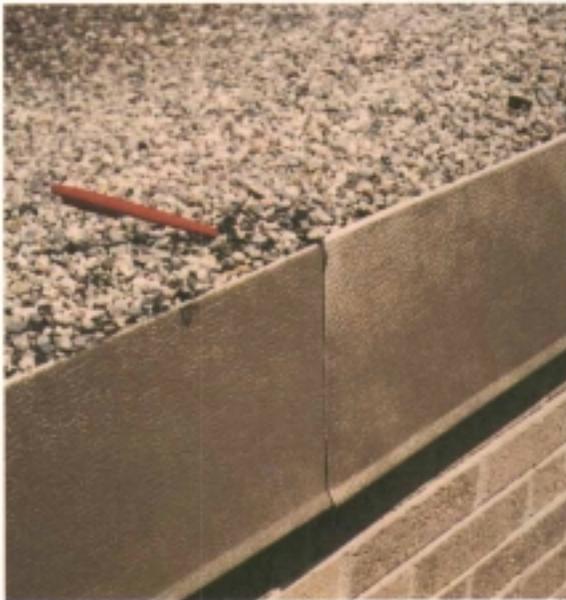

EM3 Embedded Edge Metal  
 <High Severity>  
 The stripping shows the beginning of a tear or break



EM4 Embedded Edge Metal  
 <High Severity>  
 The metal is loose or lifted

Embedded Edge Metal (EM)



EM5 Embedded Edge Metal  
<Medium Severity>  
Stripping felts are missing



EM6 Embedded Edge Metal  
<High Severity>  
The stripping is torn or broken




EM7 Embedded Edge Metal  
<High Severity>  
The metal movement has torn the stripping



EM8 Embedded Edge Metal  
<High Severity>  
The stripping felts are torn

Embedded Edge Metal (EM)

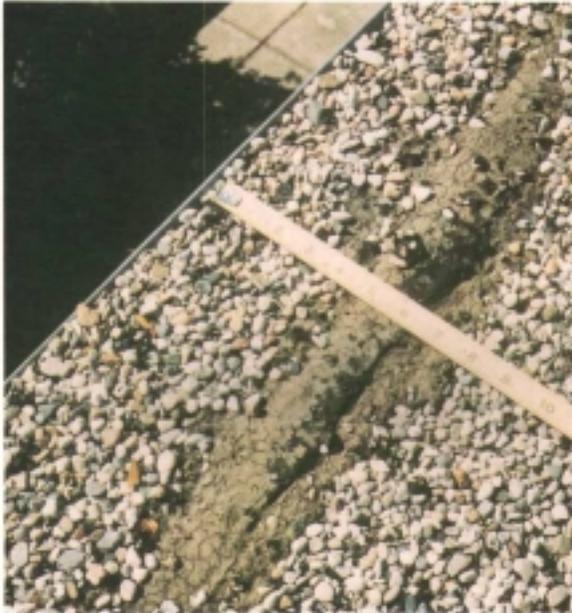

EM9 Embedded Edge Metal  
 <High Severity>  
 The stripping felt is torn along the back edge of the embedded metal



EM10 Embedded Edge Metal  
 <High Severity>  
 The edge metal is bent or deformed; the stripping is torn



EM11 Embedded Edge Metal  
 <High Severity>  
 The stripping is torn

Embedded Edge Metal

## FLASHED PENETRATIONS

**Description:** Open pipes, plumbing vent stacks, flues, ducts, continuous pipes, guy wires, drain sumps, and other penetrations through the roof membrane (excluding pitch pans but including metal curbing for hatches and ventilators, where the flange is stripped into the membrane).

### Severity Levels:

**Low:** Either of the following conditions:

1. Flashing sleeve is deformed.
2. Opening in the penetration or flashing is less than 6 in. above the roof surface.

**Medium:** Any of the following conditions:

1. Edge of stripping felts is exposed but there is no apparent felt deterioration.
2. Top of flashing sleeve is not sealed or has not been rolled down into an existing plumbing vent stack.
3. The sleeve or umbrella is open or no umbrella is present (where required).
4. Metal is corroded.

**High:** Any of the following conditions:

1. Flashing sleeve or metal curb has been installed with no stripping felts.
2. Flashing sleeve or metal curb is cracked, broken, or corroded through.
3. No flashing sleeve is present.
4. Penetration is not sealed at the membrane level.



**Measurement:** Count each distressed flashed penetration as one linear ft at the highest severity level which exists. For metal curbs and ducts with greater than 1 ft of perimeter, count the actual length (in feet) of distressed perimeter.

### Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = lineal feet of distressed flashed penetrations  
 B = total length of flashed perimeter of roof section being rated (including flashings for penthouses, courtyards and curbed projections)

**Note:** The problem density is calculated for each existing severity level.

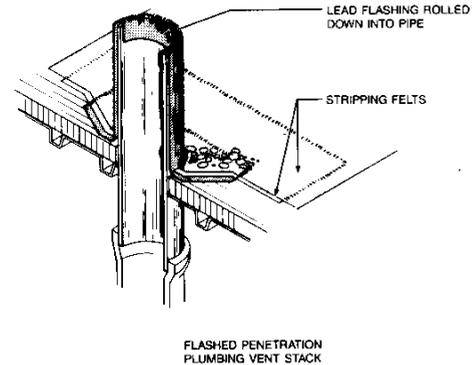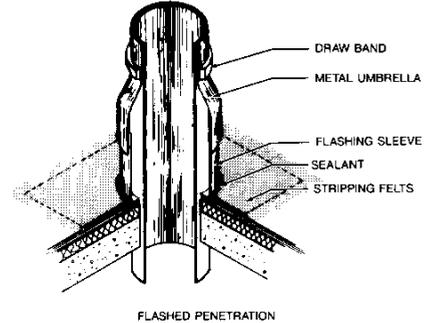





FP1 Flashed Penetration  
 <Low Severity>  
 The vent stack is distorted due to movement of the membrane



FP2 Flashed Penetration  
 <Low Severity>  
 The top of the flashing is less than 6 in. above the finished roof

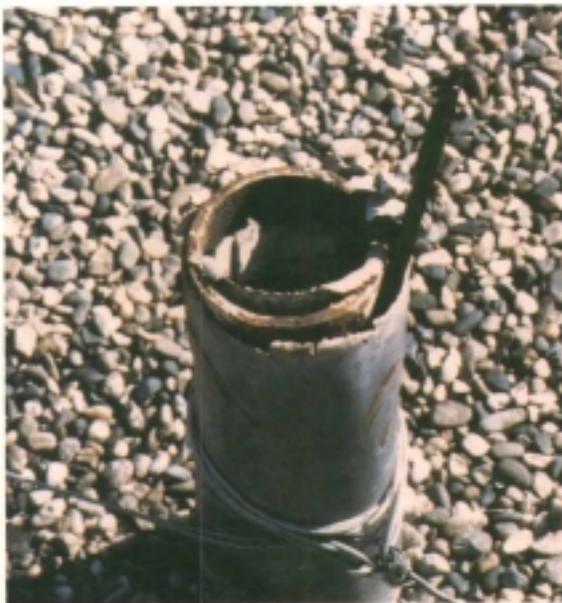

FP3 Flashed Penetration  
 <Low Severity>  
 The top of flashing sleeve is not sealed

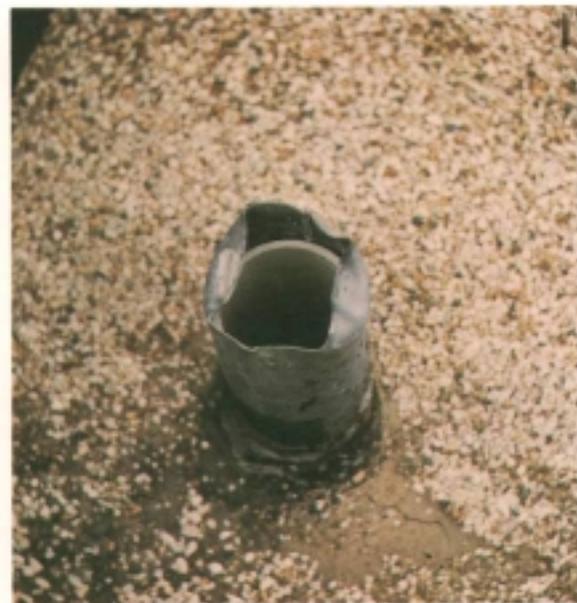

FP4 Flashed Penetration  
 <Medium Severity>  
 The lead had not been rolled down into the vent

Flashed Penetrations (FP)



**FP5** Flashed Penetration  
<Medium Severity>  
The seal at the umbrella is broken



**FP6** Flashed Penetration  
<Medium Severity>  
The flashing curb has not been stripped-in



**FP7** Flashed Penetration  
<Medium Severity>  
The flashing sleeve is cracked or broken



**FP8** Flashed Penetration  
<Medium Severity>  
The flashing umbrella is missing


Flashed Penetrations (FP)



FP9 Flashed Penetration  
<High Severity>  
The lead flashing is broken



FP10 Flashed Penetration  
<High Severity>  
The joint in the metal sleeve has failed

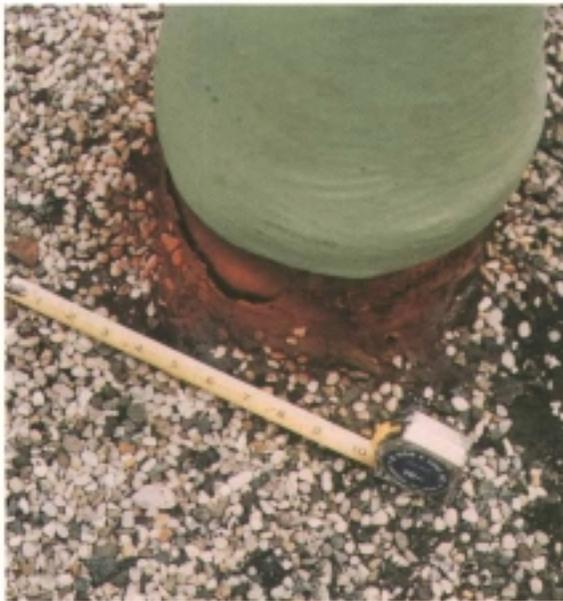

FP11 Flashed Penetration  
<High Severity>  
The metal has corroded and holes are evident



FP12 Flashed Penetration  
<High Severity>  
The metal flashing has been left out

Flashed Penetrations (FP)



FP13 Flashed Penetration  
<High Severity>  
Unflashed pipe penetration sealed  
with roofing cement



FP14 Flashed Penetration  
<High Severity>  
Guy wire anchor has not been  
flashed



FP15 Flashed Penetration  
<High Severity>  
The sleeve around the penetration is  
missing; the conduit is lying on the  
roof without supports

Flashed Penetrations (FP)

## PITCH PANS

**Description:** A pitch pan is a flanged metal sleeve placed around a roof-penetrating element and filled with a sealer.

### Severity Levels:

#### Low:

1. Pitch pans are rated low severity as a minimum due to the maintenance problems associated with them.

#### High: Any of the following conditions:

1. Metal corrosion.
2. Sealing material is below metal rim.
3. Stripping felts are exposed or deteriorated.
4. Sealing material has cracked or separated from pan or penetration.

**Measurement:** Each distressed pitch pan should be counted once at the highest severity level which exists.


#### Density:


$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = number of distressed pitch pans

B = total length of flashed perimeter of roof section being rated (including flashings for penthouses, courtyards, and curbed projections)

Note: The problem density is calculated for each existing severity level.

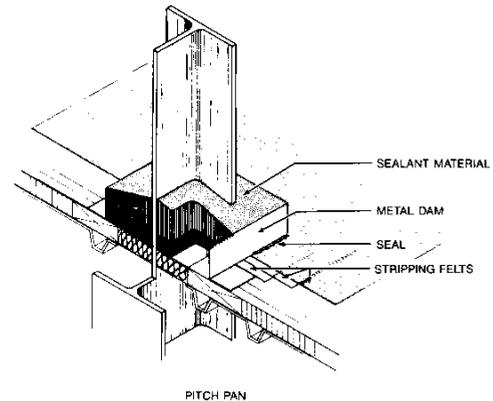

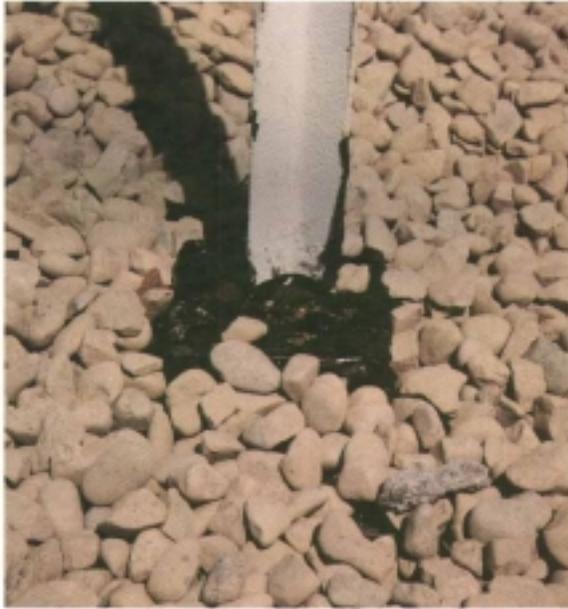

PP1 Pitch Pans  
<Low Severity>  
Pitch pan installed and maintained correctly but presents a hazard



PP2 Pitch Pans  
<High Severity>  
Metal shows light corrosion



PP3 Pitch Pans  
<High Severity>  
Water standing in pitch pan; fill material not complete



PP4 Pitch Pans  
<High Severity>  
Fill material is low; water standing in pan


Pitch Pans (PP)



PP5 Pitch Pans  
 <High Severity>  
 Sides of pan are distorted; fill material is low



PP6 Pitch Pans  
 <High Severity>  
 Pipe sleeve used as pitch pan has not been filled

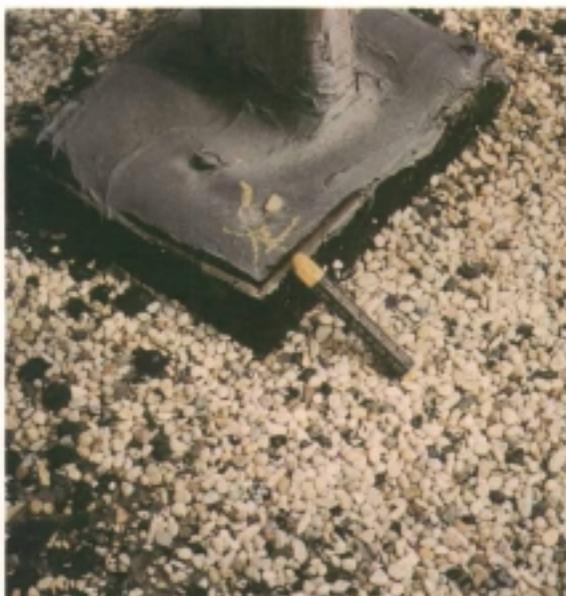


PP7 Pitch Pans  
 <High Severity>  
 Fill material has pulled away from the sides of the pan



PP8 Pitch Pans  
 <High Severity>  
 Material has pulled away; water can penetrate pan

Pitch Pans (PP)

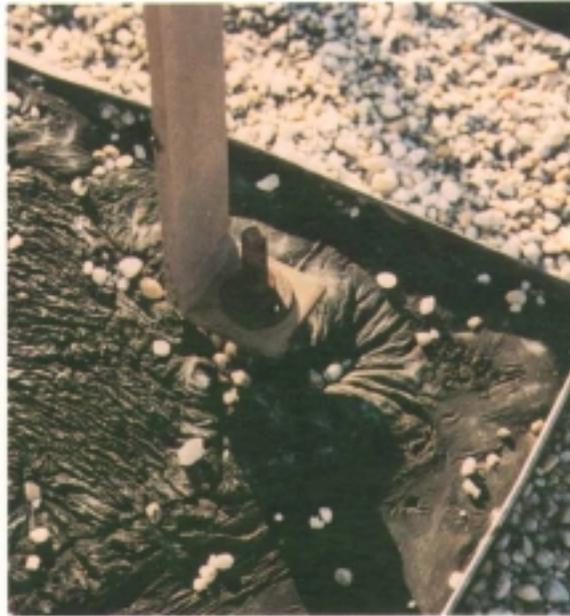

PP9 Pitch Pans  
<High Severity>  
Pan not full

Pitch Pans (PP)

## INTERIOR DRAINS AND ROOF LEVEL SCUPPERS

**Description:** A drain is a penetration at the roof membrane which allows water to flow from the roof surface into a piped drainage system. The drain fixture at the roof has a flange and/or clamping arrangement to which the roofing membrane is attached. A roof level scupper is a channel through a parapet or raised roof edge which is designed for peripheral drainage of the roof.

**Note:** Stripping felts around scuppers should be carefully inspected for holes at corners.

### Severity Levels:

#### Low:

1. Bitumen has flowed into the drain leader but the drain is not clogged.

#### Medium: Any of the following conditions:

1. Stripping felts are exposed but there is no apparent deterioration of felts.
2. Strainer is broken or missing.
3. Scupper shows loss of paint or protective coating or start of metal corrosion.

#### High: Any of the following conditions:

1. Stripping felts have holes or are deteriorated.
2. Clamping ring is loose or missing from drain body or bolts are missing.
3. Drain is clogged.
4. Scupper metal is broken or holes have occurred through the metal.

**Measurement:** Each distressed drain and scupper should be counted once at the highest severity level which exists.



#### Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = number of distressed interior drains and roof level scuppers  
 B = total length of flashed perimeter of roof section being rated (including flashings for penthouses, courtyards and curbed projections)

**Note:** The problem density is calculated for each existing severity level.

Interior Drains and Roof Level Scuppers (DR)

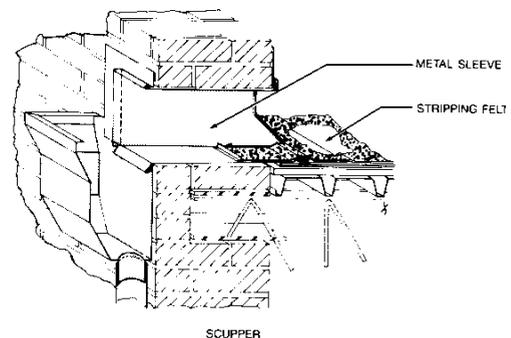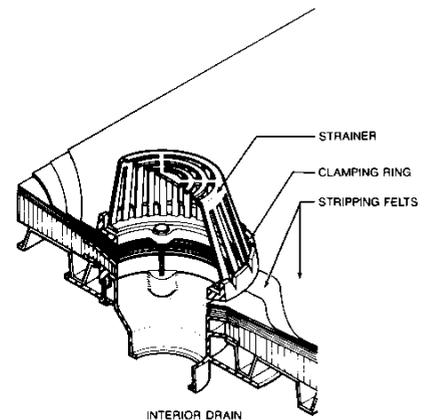




DR1 Drains and Scuppers  
 <Low Severity>  
 Bituminous material has flowed into the drain



DR2 Drains and Scuppers  
 <Medium Severity>  
 The felts around the drain are exposed



DR3 Drains and Scuppers  
 <Medium Severity>  
 The strainer is broken

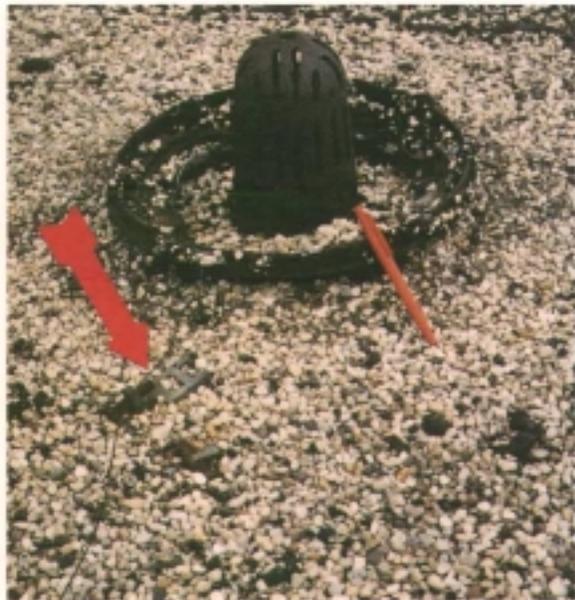


DR4 Drains and Scuppers  
 <High Severity>  
 The clamping ring is loose. Bolts are lying next to the ring

Interior Drains and Roof Level Scuppers (DR)



DR5 Drains and Scuppers  
<High Severity>  
The clamping ring is missing; also, the strainer is broken and the drain is clogged with bitumen

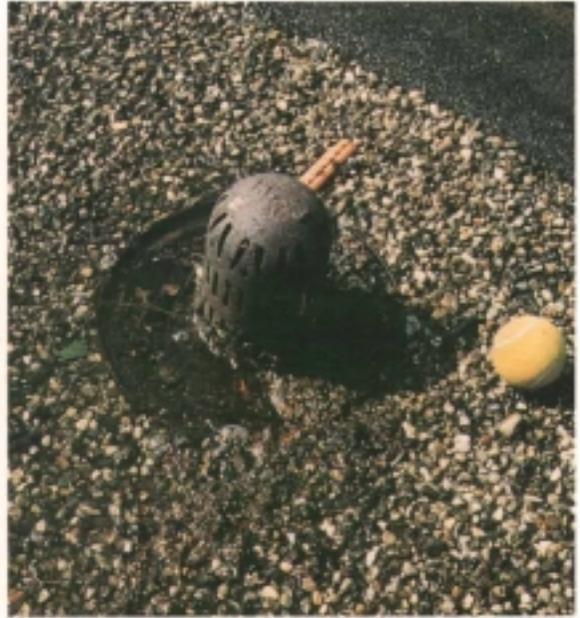

DR6 Drains and Scuppers  
<High Severity>  
The drain is clogged



DR7 Drains and Scuppers  
<High Severity>  
The drain is clogged, the clamping ring is missing, and the strainer is broken



DR8 Drains and Scuppers  
<High Severity>  
The drain is clogged

Interior Drains and Roof Level Scuppers (DR)

#### 4 MEMBRANE DISTRESSES


##### Index

<u>Distress</u>	<u>Page</u>
Blisters .....	54
Ridges .....	57
Splits .....	60
Holes .....	62
Surface Deterioration .....	63
Slippage .....	68
Patching .....	70
Debris and Vegetation .....	73
Improper Equipment Supports .....	76
Ponding .....	80

## BLISTERS

**Description:** Blisters are round or elongated raised areas of the membrane which are filled with air.

**Note:** Blisters and ridges are difficult to differentiate at the low and medium severity levels. The rating error will be insignificant because of the similarity in the deduct curves. At high severity, however, it is important to distinguish between the two distresses due to their different leak potentials.

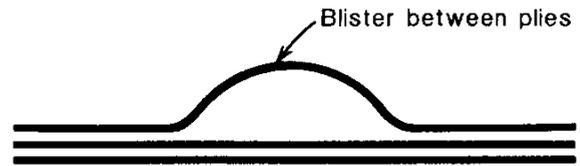

Graphic Representation  
of Blister

### Severity Levels:

#### Low:

1. The raised areas are noticeable by vision or feel. The surfacing is still in place and the felts are not exposed.

#### Medium:

1. The felts are exposed or show deterioration.

#### High:

1. The blisters are broken.

### Measurement:

1. Measure the length and width of the blister in lineal feet and calculate the area (length times width). If the distance between individual blisters is less than 5 ft, measure the entire affected area in sq ft.
2. When large quantities of this problem are present (especially on large roofs), the representative sampling technique can be used.

### Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = total area of membrane blisters (sq ft)  
B = total area of roof section being rated (sq ft)

**Note:** The problem density is calculated for each existing severity level.

**Causes:** Blisters are caused by voids or lack of attachment within the membrane. Moisture and gasses within the void greatly increases the potential for growth.

Blisters (BL)




BL1 Blisters  
<Low Severity>  
Low severity blisters.  
The surface is still in place



BL2 Blisters  
<Low Severity>  
Large blister but still low severity  
level



BL3 Blisters  
<Low Severity>  
Blisters in walk-pad application

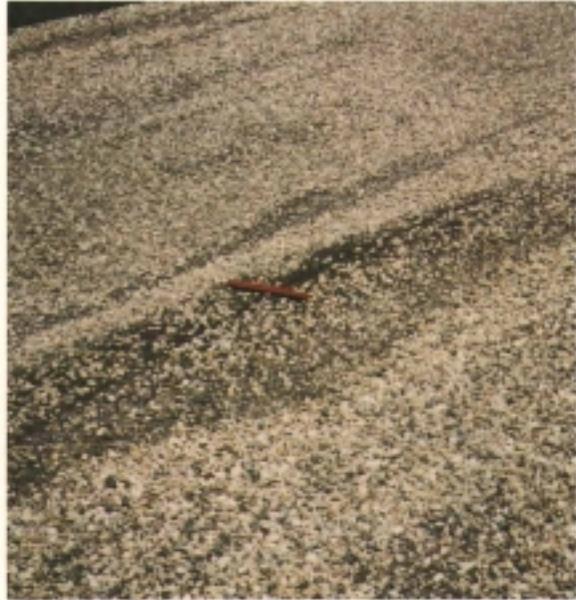

BL4 Blisters  
<Low Severity>  
Blisters in gravel surfaced  
membrane

Blisters (BL)



BL5 Blisters  
<Low Severity>  
General blistering over all of roof surface



BL6 Blisters  
<Low Severity>  
Blisters in cap sheet



BL7 Blisters  
<Medium Severity>  
Blister is bare and felts are starting to show wear




BL8 Blisters  
<High Severity>  
Blister has broken

Blisters (BL)

## RIDGES

**Description:** Ridges are long, narrow (usually less than 3 in.), raised portions of the roof membrane. Their maximum height is about 2 in. Usually ridges occur directly above the insulation board joints and run perpendicular or parallel to the felts. They include all the plies and therefore are generally stiffer than blisters.

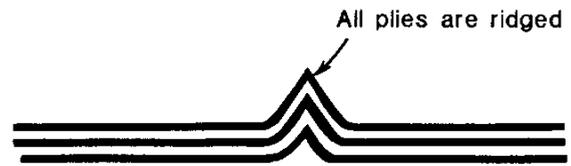

Graphic Representation  
of Ridge

**Note:** Blisters and ridges are difficult to differentiate at the low and medium severity. The rating error will be insignificant because of the similarity in the deduct curves. However at the high severity, it is important to distinguish between the two distresses due to their different leak potentials.

### Severity Levels:

#### Low:

1. The ridges are noticeable but the felts are not exposed.

#### Medium:

1. The ridges are raised and clearly visible. The surfacing on the ridge is gone and the top felt is exposed.

#### High: Either of the following conditions:

1. Open breaks have developed in the ridge.
2. Felt deterioration has progressed through the top ply, exposing underlying plies.

**Measurement:** Measure lineal feet of ridges running in all directions.

#### Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = total length of membrane ridges (ft)  
B = total area of roof section being rated (sq ft)


**Note:** The problem density is calculated for each existing severity level.

**Causes:** Ridging can be the result of internally generated moisture vapor collecting at insulation joints and affecting the membrane or of movement of the substrate.

Ridges (RG)



RG1 Ridges  
 <Low Severity>  
 Beginnings of ridges evident in surface; some picture framing evident

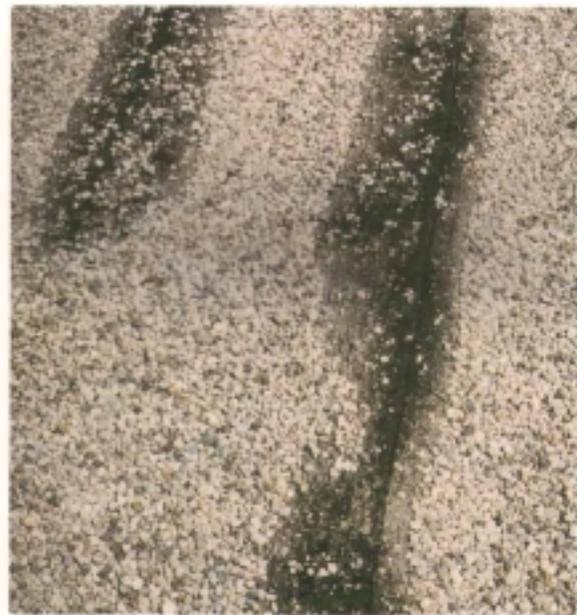

RG2 Ridges  
 <Medium Severity>  
 Closeup of medium severity ridging condition



RG3 Ridges  
 <Low Severity>  
 Ridges in a smooth surface membrane




RG4 Ridges  
 <Medium Severity>  
 Bare felt showing; some slippage of felt at lap is evident

Ridges (RG)



RG5 Ridges  
 <Medium Severity>  
 Smooth surface membrane

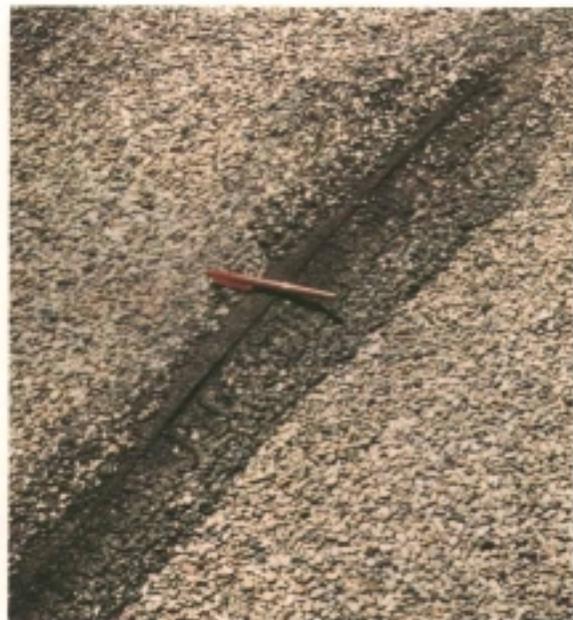

RG6 Ridges  
 <High Severity>  
 Felts are distorted; felt lap is opening up; first felt shows deterioration



RG7 Ridges  
 <High Severity>  
 Ridge has collapsed; felt is broken or torn

Ridges (RG)

## SPLITS

**Description:** Splits are tears that extend through all membrane felts. They vary in length from a few feet to the length of the roof and in width from a hair-line crack to more than 1 in. Splits generally occur directly above the joints between the long sides of insulation boards and run in the direction the felts were installed.



Graphic Representation  
of Split

### Severity Levels:

#### High:

1. An unrepaired split or a repaired split which has started to re-open.

**Measurement:** Measure lineal feet of split.

#### Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = total length of membrane splits (ft)  
B = total area of roof section being rated (sq ft)

#### Causes:

1. The membrane is too weak.
2. There is little or no attachment between any of the following: membrane, insulation, vapor retarder (if any), and deck.
3. Areas of the membrane have missed headlaps.
4. Differential movement at deck joints.
5. Structural movement within the roof system.
6. Stress concentration due to shrinkage cracking of a poured deck.



SP1 Splits  
 <High Severity>  
 Long split over structural member;  
 yellow markings indicate water  
 penetration determined by infrared  
 (IR) scanning



SP2 Splits  
 <High Severity>  
 Closeup of split in gravel surface;  
 repair attempt made using mastic  
 without reinforcing fabric



SP3 Splits  
 <High Severity>  
 Large split in gravel surface roof



SP4 Splits  
 <High Severity>  
 Split in mineral cap sheet

Splits (SP)

## HOLES

**Description:** A membrane hole is any visible opening which extends through all membrane layers. Holes can be of various sizes and shapes, and can be located anywhere on the roof surface.

### Severity Levels:

#### High:

1. All holes in the membrane are considered high severity due to their high leak potential.

**Measurement:** Count the total number of holes in the membrane. If the distance between two holes is less than 1 ft, count them as one hole.

#### Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = number of membrane holes

B = total area of roof section being rated (sq ft)



HL1 Holes  
<High Severity>  
Membrane below gravel surface has been penetrated by a sharp object



HL2 Holes  
<High Severity>  
Holes in smooth surfaced roof

Holes (HL)

## **SURFACE DETERIORATION**

**Description:** A built-up roofing membrane will generally have one of the following types of surfacing: aggregate surface, mineral surface-cap or smooth surface-coated. The membrane surface may show any of the following distressed conditions:

1. Lack of top surface or coating.
2. Alligating (interconnected hairline cracks that resemble alligator hide).
3. Lack of adhesion between the membrane plies.

Note: Walkways are treated as part of the membrane surfacing.

### **Severity Levels:**

**Low:** Any of the following conditions:

1. On aggregate surfaced roofs, the aggregate is not embedded or is poorly embedded but the felts remain covered with aggregate.
2. Open edge laps or fishmouths.
3. On smooth surfaced roofs, there is evidence of crazing of top surface with hairline cracks (alligating).
4. Walkway shows loss of surfacing, loss of adhesion, cracks, blistering or cracked coating.

**Medium:** Any of the following conditions:

1. On aggregate surfaced roofs, the aggregate is displaced and the top coat of bitumen is exposed.
2. On mineral surfaced-cap sheet roofs, the mineral granules have come off the cap sheet, exposing the underlying felt.
3. On smooth surfaced roofs, no surface coating exists or there is a loss of surface coating.
4. On smooth surfaced roofs, alligator cracks extend down through the bitumen to the top felt.

**High:** Any of the following conditions:

1. On aggregate surfaced roofs, the aggregate cover has been displaced and the bitumen pour coat is deteriorated, leaving the underlying felts exposed. The felts may be deteriorated.
2. On mineral surfaced-cap sheet roofs, the cap sheet felt is deteriorated.
3. On smooth surfaced roofs, alligator cracks extend down through one or more plies.
4. Shrinking of the walkway has torn the membrane below it.

**Measurement:**

1. Measure square feet of each affected area and rate at highest severity level which exists.
2. When large quantities of this problem are present (especially on large roofs), the representative sampling technique can be used.

**Density:**

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = total area of surface deterioration (sq ft)  
B = total area of roof section being rated (sq ft)

Note: The problem density is calculated for each existing severity level.

**Causes:**

1. Inadequate top pour coat.
2. Little or no embedment of aggregate.
3. Wind erosion such as occurs at roof corners and water erosion such as occurs when downspouts empty directly onto the membrane.
4. Use of bitumen on a slope that is greater than proper for that bitumen. The bitumen and gravel run off, leaving the felts exposed. This can affect localized areas or the entire roof.
5. Alligatoring results from overapplication of bitumen or aging bitumen, combined with weathering and temperature cycling. The bitumen gradually loses the ability to flow back together and alligatoring is enhanced.



SR1 Surface Deterioration  
 <Low Severity>  
 Gravel is loose and easily displaced  
 by wind; imbedment of gravel is minimal  
 <Medium Severity>  
 Bare areas



SR2 Surface Deterioration  
 <Low Severity>  
 There are open edge laps or  
 fishmouths



SR3 Surface Deterioration  
 <Low Severity>  
 Walkways are cracked or blistered




SR4 Surface Deterioration  
 <Low Severity>  
 Hairline alligator cracking of the  
 surface is evident


Surface Deterioration (SR)



SR5 Surface Deterioration  
<Medium Severity>  
Granule surface on cap sheet is eroded

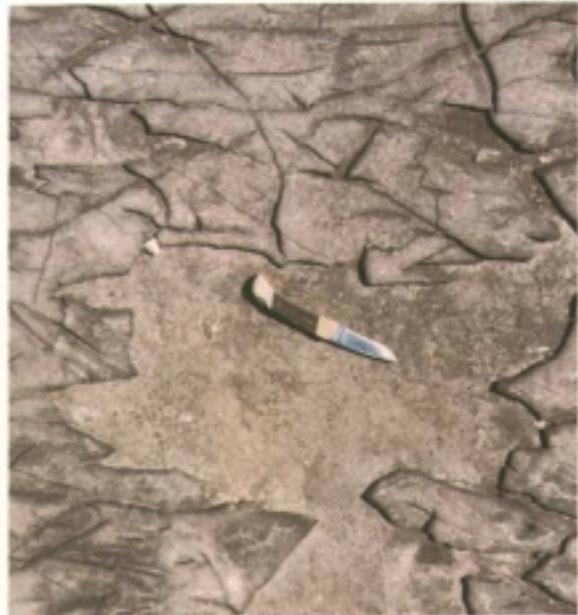

SR6 Surface Deterioration  
<Medium Severity>  
Loss of surface coating on  
smooth surface roof

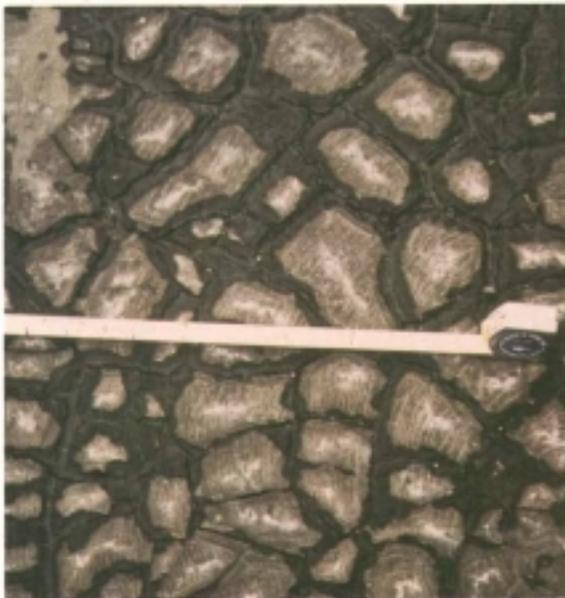


SR7 Surface Deterioration  
<Medium Severity>  
Alligator cracking of the surface  
extends down to the felt



SR8 Surface Deterioration  
<Medium Severity>  
Alligator cracking of the surface  
extends down to the felt

Surface Deterioration (SR)

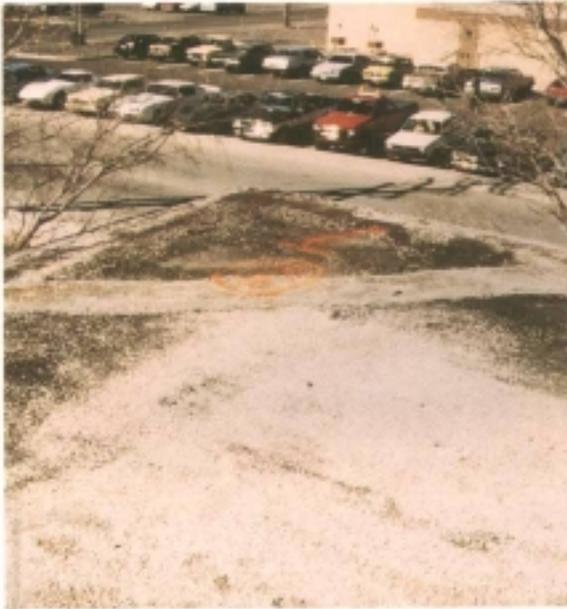

SR9 Surface Deterioration  
 <Medium Severity>  
 Gravel surfacing shows erosion from wind coming over corner of building



SR10 Surface Deterioration  
 <High Severity>  
 Gravel surfacing is gone and felts are starting to show wear



SR11 Surface Deterioration  
 <High Severity>  
 Smooth surface membrane is deteriorated



SR12 Surface Deterioration  
 <High Severity>  
 Cap sheet is completely worn and felt is torn or broken

Surface Deterioration (SR)

## SLIPPAGE

**Description:** Slippage is a downslope lateral movement of felt plies. Slippage usually occurs on roofs with slopes greater than 1/4 in./ft.

### Severity Levels:

#### Low:

1. Less than 2 in. of slippage has occurred, evidenced by the presence of narrow bare strips perpendicular to the slope.

Note: Low severity slippage requires inspection at 6 month intervals.

#### High:

1. More than 2 in. of slippage has occurred. There is evidence of humping and wrinkling.

**Measurement:** Measure square feet of affected roof area. The affected area extends from the high point on the slope where bare felts are noticeable, down to the low point of the slope or the area where humping and wrinkling are noticeable.

#### Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = total affected area of roof (sq ft)  
B = total area of roof section being rated (sq ft)

Note: The problem density is calculated for each existing severity level.

#### Causes:

1. Inadequate fastening of felts for the amount of roof slope present.
2. Use of improper bitumen.
3. Thickness of asphalt interply moppings is too great, reducing horizontal shear resistance between felt plies.
4. Phased construction, where the base sheet is glazed and felts applied at a later date.



SL1 Slippage  
<Low Severity>  
Slippage lines can be seen in the  
roof surface



SL2 Slippage  
<High Severity>  
Slippage is greater than 2 in.



SL3 Slippage  
<High Severity>  
Slippage is evident in surface and  
is greater than 2 in.

Slippage (SL)

## **PATCHING**

**Description:** A localized repair of the membrane done with cold-applied roofing cement with fabric or felt embedded in it, with hot bitumen and felts, or with a modified bitumen system. It should be obvious that the work is not part of the original roof construction.

### **Severity Levels:**

#### **Low:**

1. All patches are rated low severity as a minimum.

#### **Medium:**

1. The materials and workmanship of the patch are not equal to or better than the existing membrane.

#### **High:**

1. Ruptures or other membrane distresses of at least medium severity are present within the patched area (count as patching distress only).

### **Measurement:**

1. Measure square feet of each patch having the above conditions.
2. When large quantities of this problem are present (especially on large roofs), the representative sampling technique can be used.

### **Density:**

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = total area of patching (sq ft)

B = total area of roof section being rated (sq ft)

**Note:** The problem density is calculated for each existing severity level.



PA1 Patching  
<Low Severity>  
Patching is evident in smooth surfaced roof.



PA2 Patching  
<Low Severity>  
Patching is evident in gravel surfaced roof



PA3 Patching  
<Medium Severity>  
Patching material is not the same as the original roof



PA4 Patching  
<High Severity>  
Patched area has a high severity blister

Patching (PA)



PA5 Patching  
<High Severity>  
Patched area has a split

## DEBRIS AND VEGETATION

### Description:

1. Foreign objects on the roof which could damage or puncture the membrane.
2. The growth of vegetation on the roof.
3. Accumulation of solvent and oil drippings on the roof.

### Severity Levels:

**Medium:** Any of the following conditions:

1. The collection of foreign objects which are not removed from the roof during the inspection.
2. Grease, solvent, or oil drippings on the roof which show no degradation of the roof membrane.
3. Evidence of vegetation, but not penetrating the felts.

**High:** Any of the following conditions:

1. Grease, solvent, or oil drippings on the roof which is causing degradation to the roofing system.
2. Vegetation roots that have penetrated the felts.

**Measurement:** Measure square feet of affected area. Each isolated case of debris and vegetation of less than 1 sq ft in area should be counted as 1 sq ft.

### Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = total area of debris and vegetation (sq ft)  
B = total area of roof section being rated (sq ft)

**Note:** The problem density is calculated for each existing severity level.



DV1 Debris and Vegetation  
Freon container left on roof;  
inspector should remove



DV2 Debris and Vegetation  
<Medium Severity>  
Accumulation of tree needles  
on roof



DV3 Debris and Vegetation  
<Medium Severity>  
Boxes of roof insulation left on roof



DV4 Debris and Vegetation  
<Medium Severity>  
Conduit and piping left on roof

Debris and Vegetation (DV)



DV5 Debris and Vegetation  
<Medium Severity>  
Grass growing on roof



DV6 Debris and Vegetation  
<Medium Severity>  
Vegetation growing on roof



DV7 Debris and Vegetation  
<Medium Severity>  
Lawn growing on roof



DV8 Debris and Vegetation  
<High Severity>  
Degradation of membrane due to  
oil or solvent drippage

Debris and Vegetation (DV)

## IMPROPER EQUIPMENT SUPPORTS

**Description:** Pipe, conduit, and mechanical equipment supports (wood sleepers, channels, etc.) which are placed directly on the roof surface with no protective pad or placed at insufficient height to allow for maintaining the membrane below the equipment. Repairing this distress may require replacing the surrounding insulation and membrane.

**Note:** Terminations for guy wires are to be rated as flashed penetrations distresses.

### Severity Levels:

#### Low:

1. All improper equipment supports are rated low severity as a minimum due to the maintenance problems associated with them.

**Medium:** Either of the following conditions:

1. Movement of the support has caused displacement of the roof surfacing but has not damaged the membrane.
2. The equipment is bolted through the membrane but the bolts appear to be sealed.

**High:** Either of the following conditions:

1. The support has caused damage to the roof membrane.
2. The equipment is bolted through the membrane and the bolts appear not to be sealed.

**Measurement:** Measure square feet of each improper equipment support. The minimum dimension for length and width of a support shall be 1 ft.

#### Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = total area of improper equipment supports (sq ft)  
B = total area of roof section being rated (sq ft)

**Note:** The problem density is calculated for each existing severity level.



EQ1 Improper Equipment Supports  
<Low Severity>  
Pipe supported by wood block



EQ2 Improper Equipment Supports  
<Low Severity>  
Conduit supported by wood blocks



EQ3 Improper Equipment Supports  
<Low Severity>  
Ductwork supported on steel channels  
which rest on the membrane, unflashed



EQ4 Improper Equipment Supports  
<Low Severity>  
Large air-conditioning unit  
supported on unflashed steel

Improper Equipment Supports (EQ)



**EQ5** Improper Equipment Supports  
<Medium Severity>  
Air handling equipment installed directly on the roof surface



**EQ6** Improper Equipment Supports  
<High Severity>  
Blocks supporting piping have moved, tearing the roof membrane



**EQ7** Improper Equipment Supports  
<High Severity>  
Angle leg set on roof without flashing



**EQ8** Improper Equipment Supports  
<High Severity>  
Equipment support has damaged membrane

Improper Equipment Supports (EQ)



EQ9 Improper Equipment Supports  
<High Severity>  
Improper A/C support and pipe penetration



EQ10 Improper Equipment Supports  
<High Severity>  
Base for antenna has not been placed on a flashed curb.  
Bolts penetrate membrane



EQ11 Improper Equipment Supports  
<High Severity>  
Antenna base is nailed to roof

Improper Equipment Supports (EQ)

## PONDING

**Description:** Standing water is present or there is evidence of ponding by the presence of staining. Water which remains after 48 hr. is considered ponded water.

### Severity Levels:

#### Low:

1. Ponding is rated low severity due to the maintenance problems associated with it.

**Measurement:** Measure square feet of affected area.

#### Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where: A = total area of ponding (sq ft)

B = total area of roof section being rated (sq ft)

#### Causes:

1. Improper design of roof drainage system.
2. Irregularities of membrane surface.
3. Clogged roof drains and seuppers or obstructions.



PD1 Ponding  
<Low Severity>  
Ponding is occurring between drains




PD2 Ponding  
<Low Severity>  
Ponding on "dead-flat" roof


Ponding (PD)



PD3 Ponding  
<Low Severity>  
Drain is blocked. Clearing of drain by the inspector will eliminate the distress

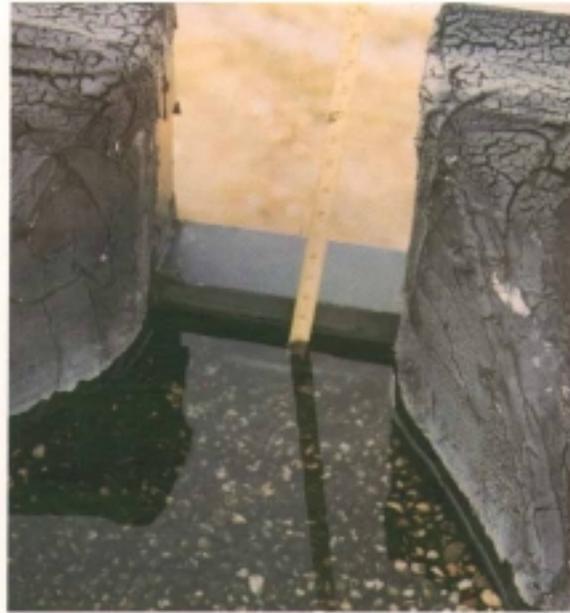

PD4 Ponding  
<Low Severity>  
Scupper edge is too high and blocks drainage

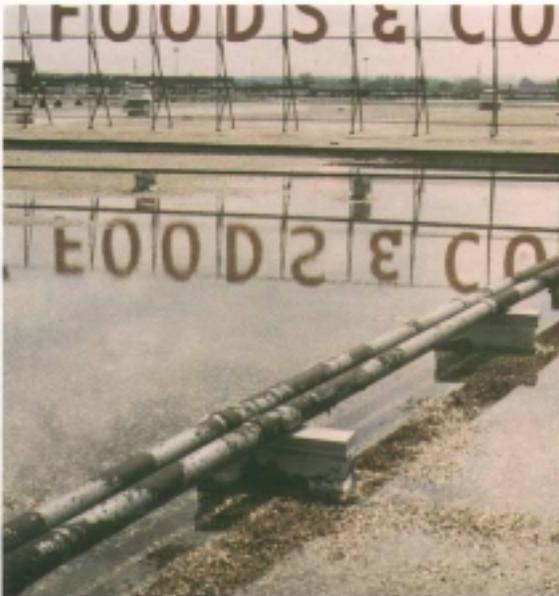

PD5 Ponding  
<Low Severity>  
General ponding due to poor drain locations




PD6 Ponding  
<Low Severity>  
Dirt accumulation on roof indicating that water ponds near the drain

Ponding (PD)



PD7 Ponding  
<Low Severity>  
Debris--indication of ponding

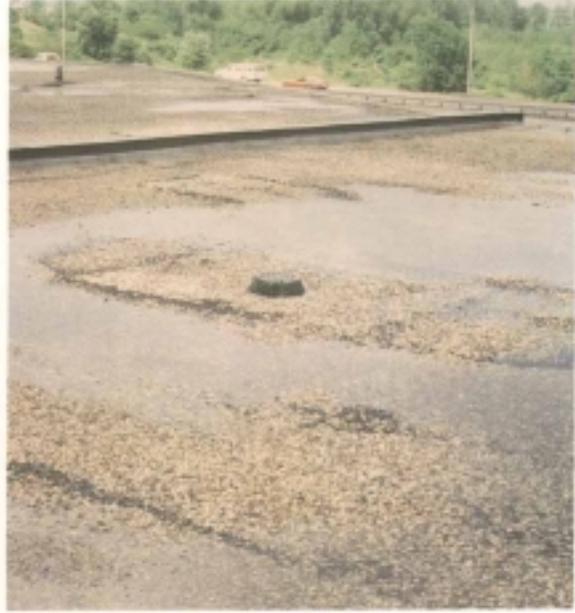

PD8 Ponding  
<Low Severity>  
Drain is placed too high



PD9 Ponding  
<Low Severity>  
Ponding on roof







PD10 Ponding  
<Low Severity>  
Evidence of ponding shown in PD9



Ponding (PD)


APPENDIX A:

DEDUCT VALUE CURVES

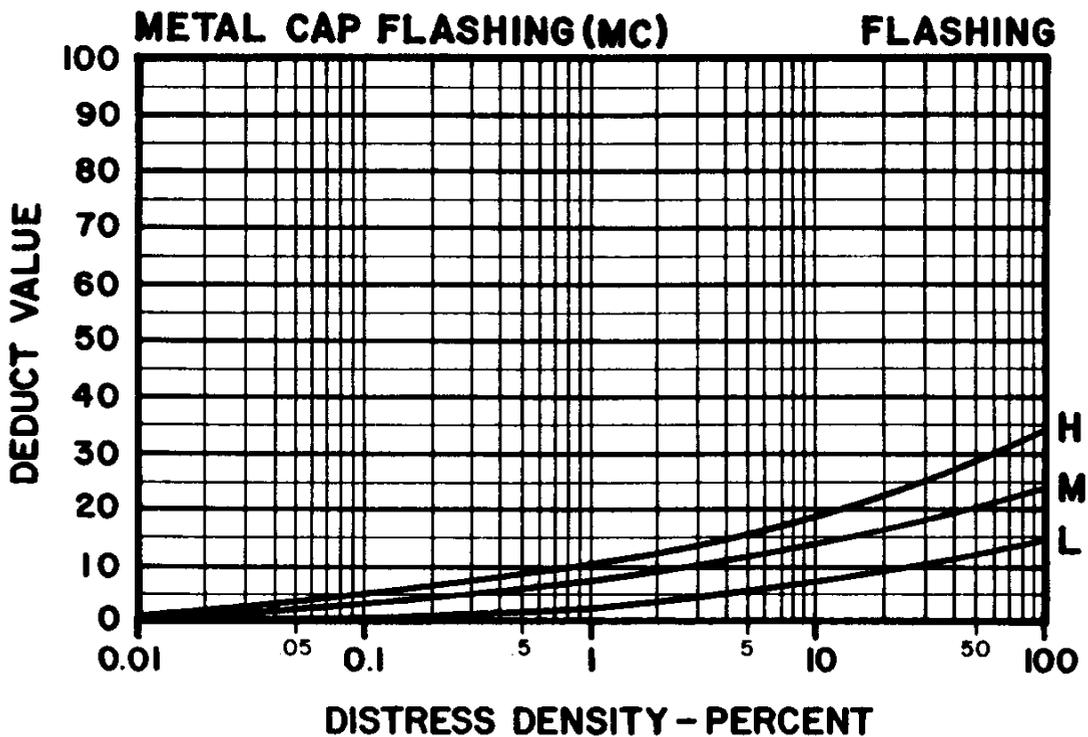
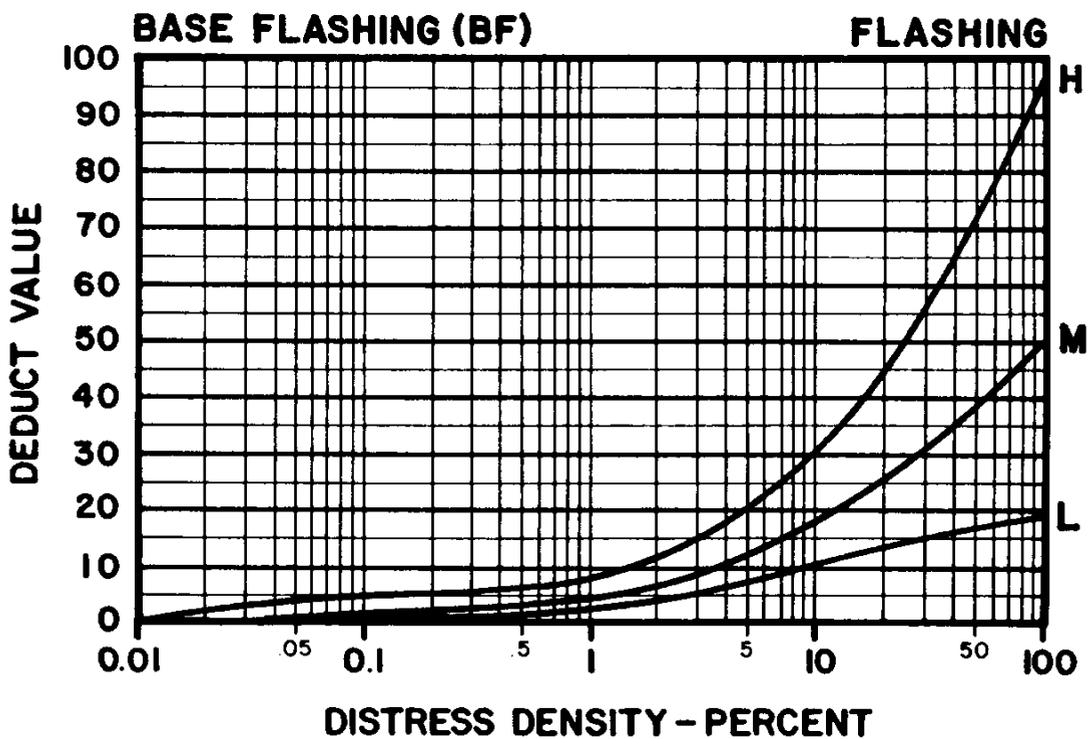


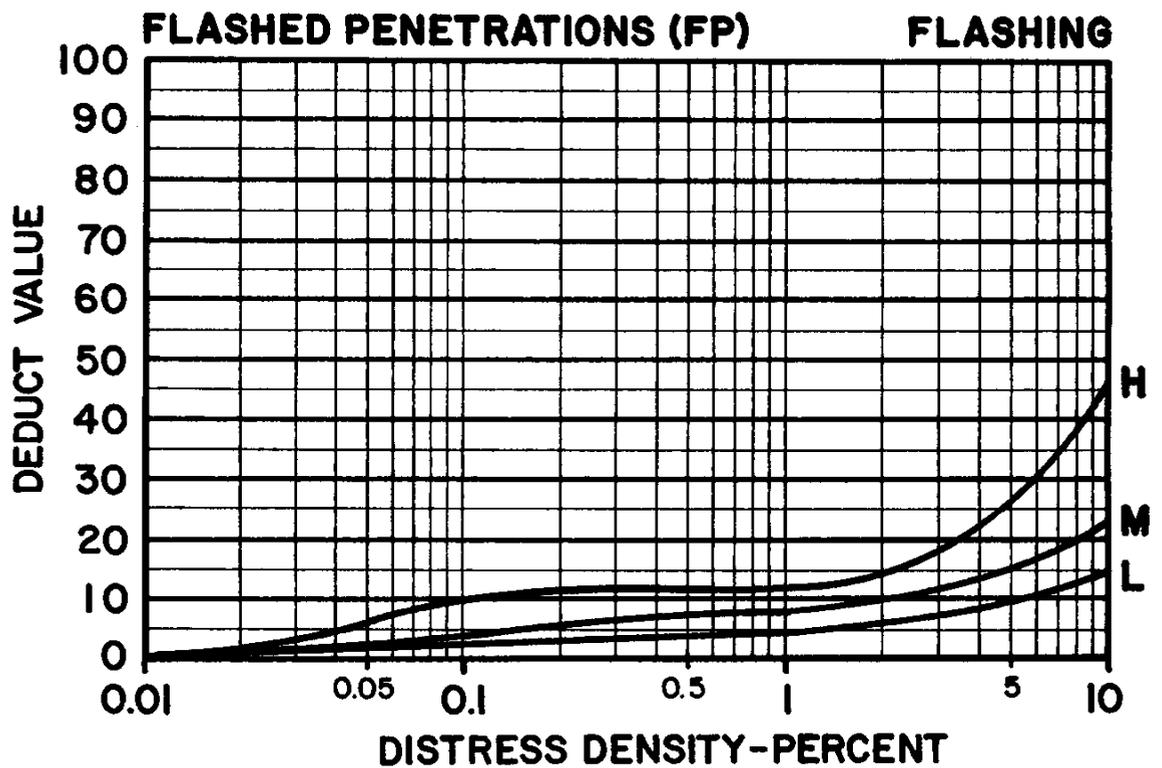
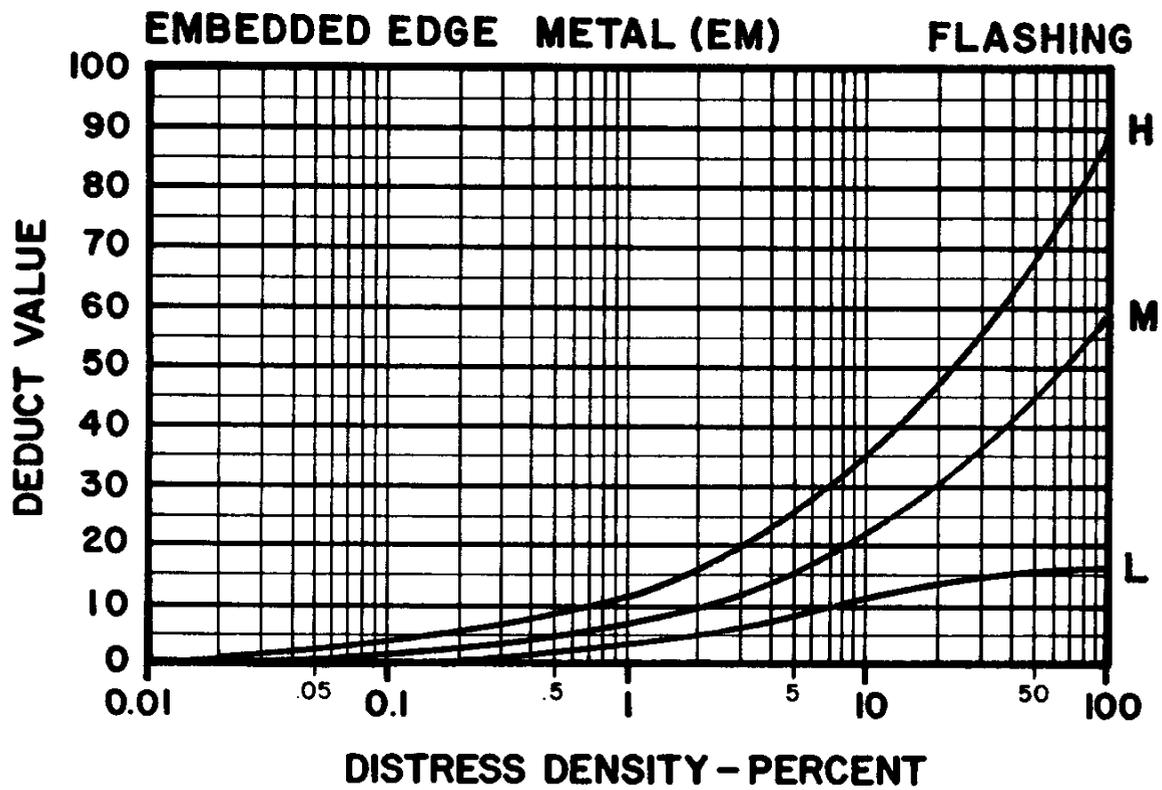


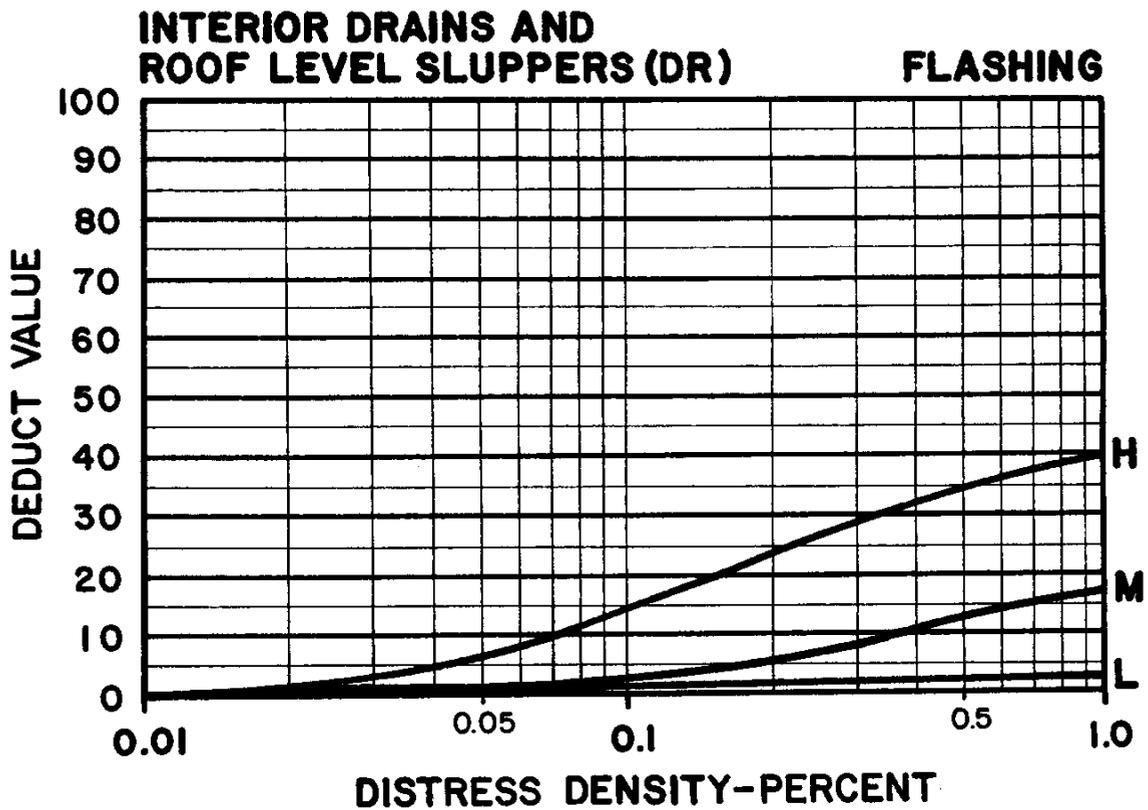
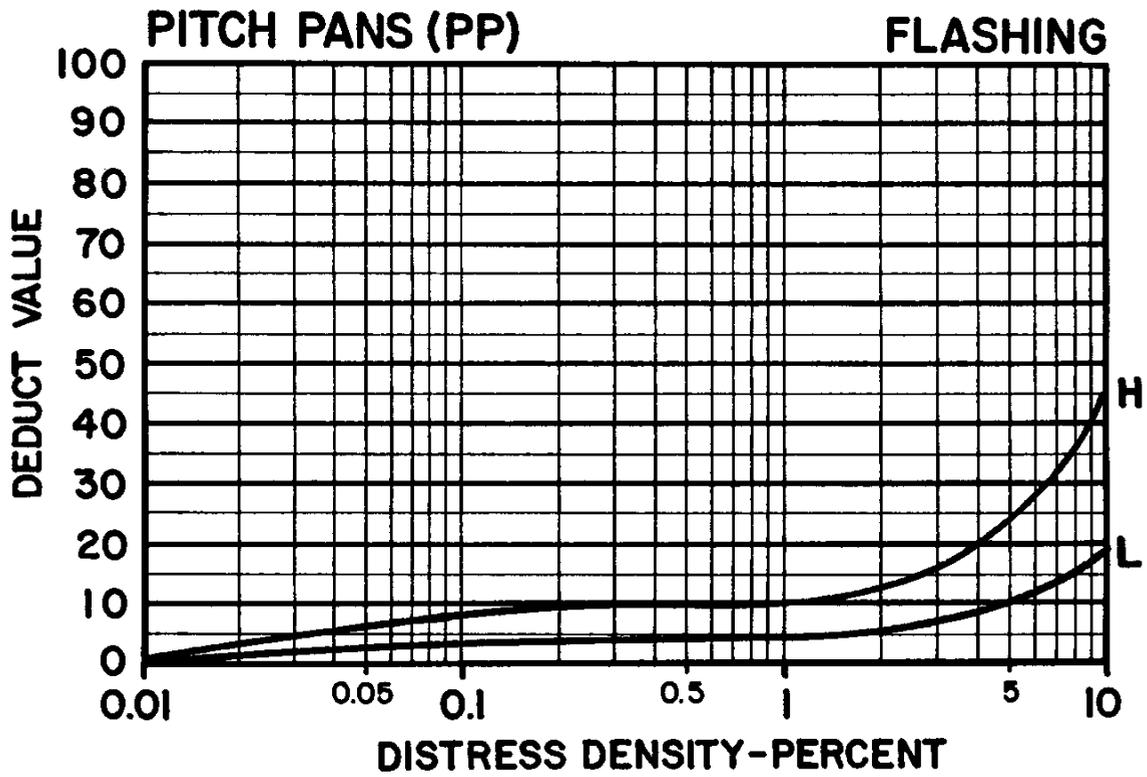



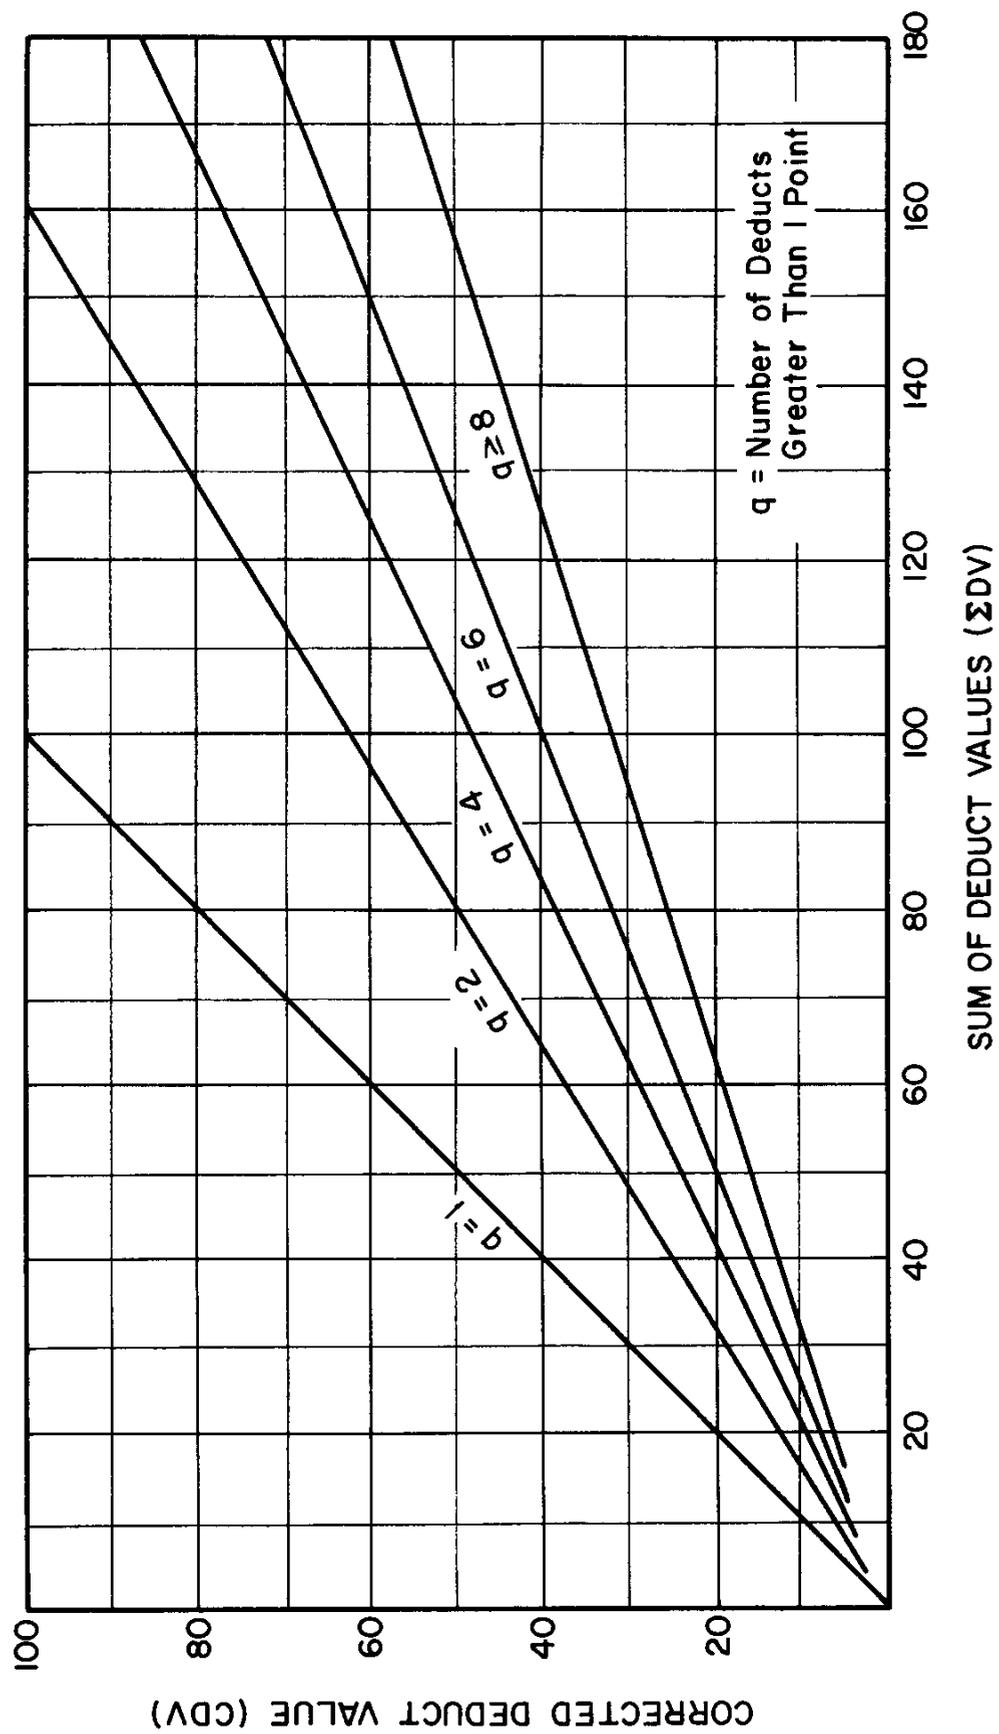




Corrected deduct values for flashing.

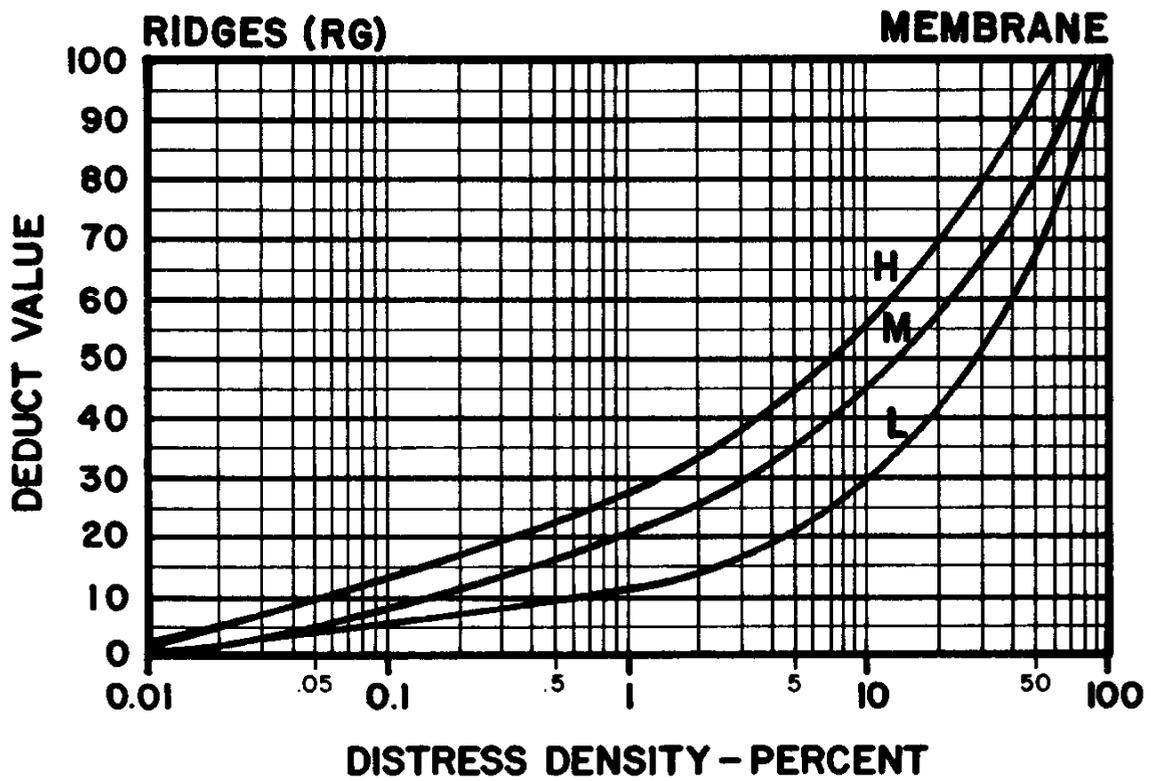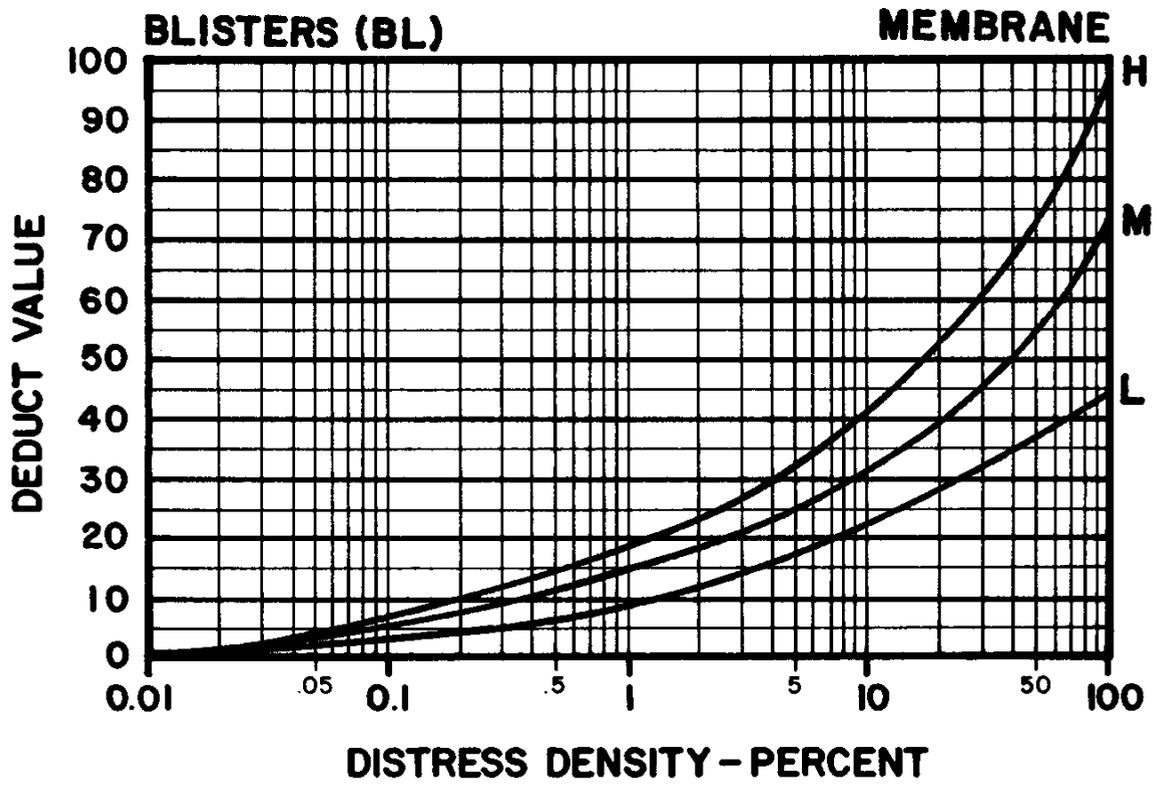


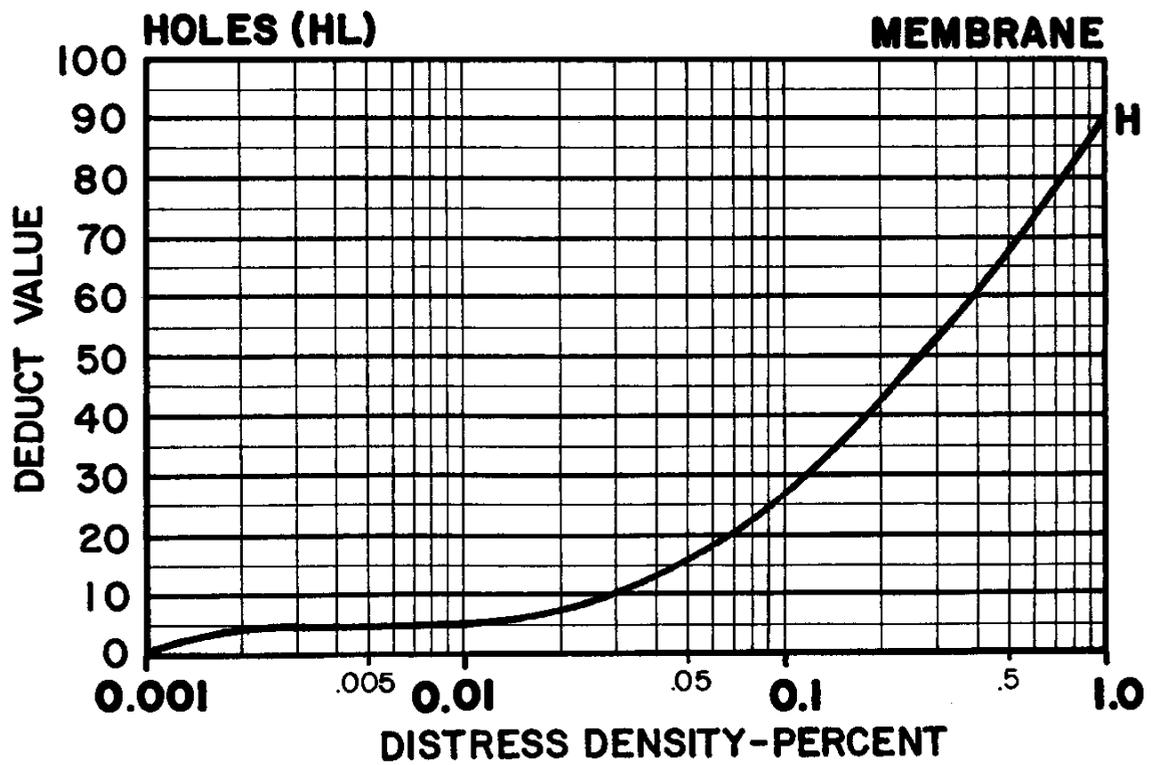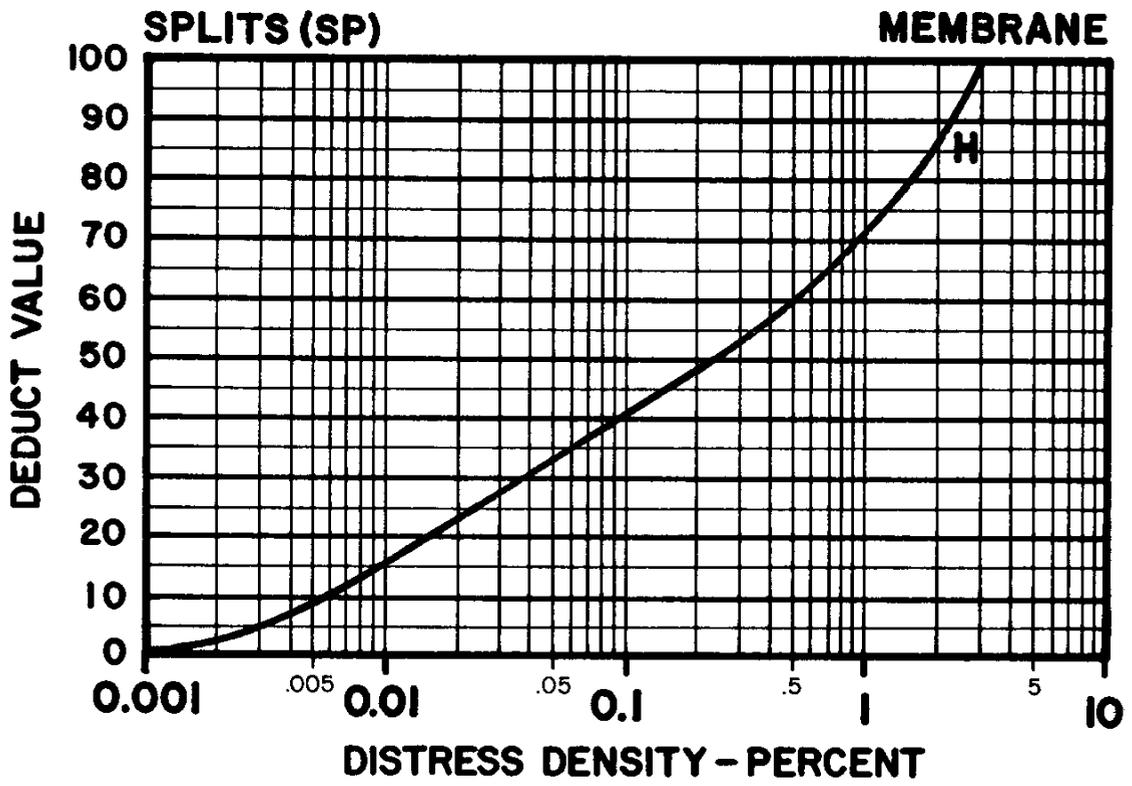

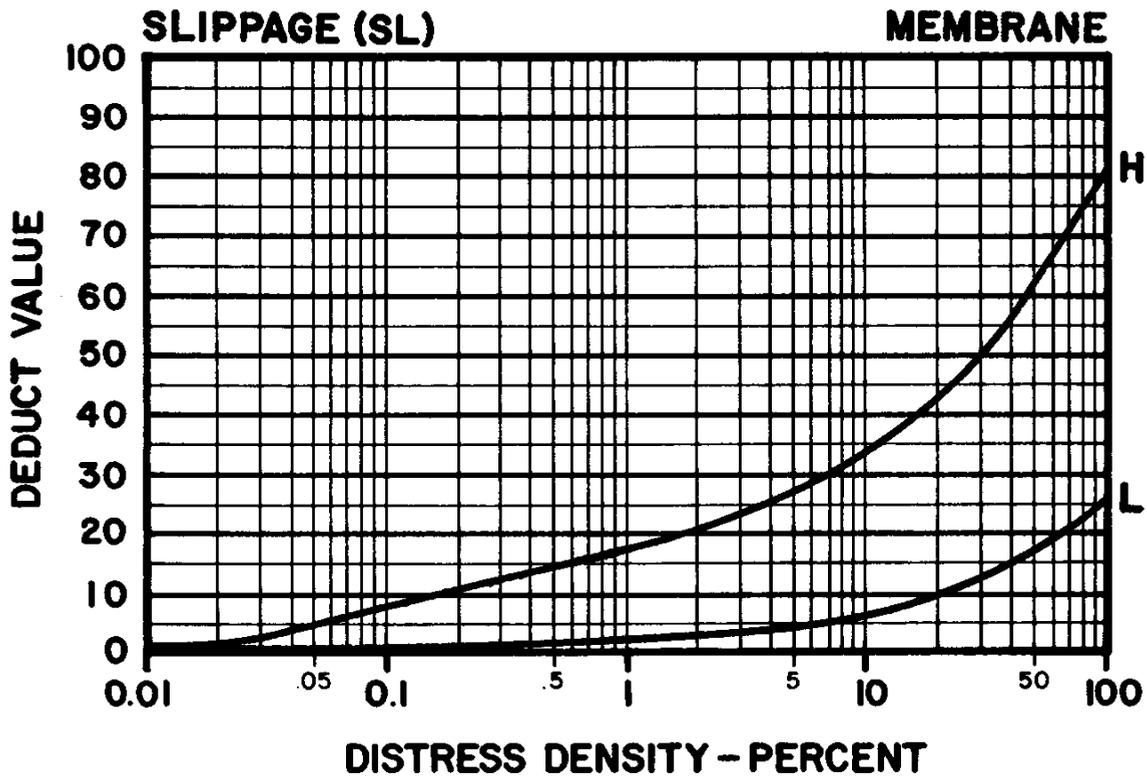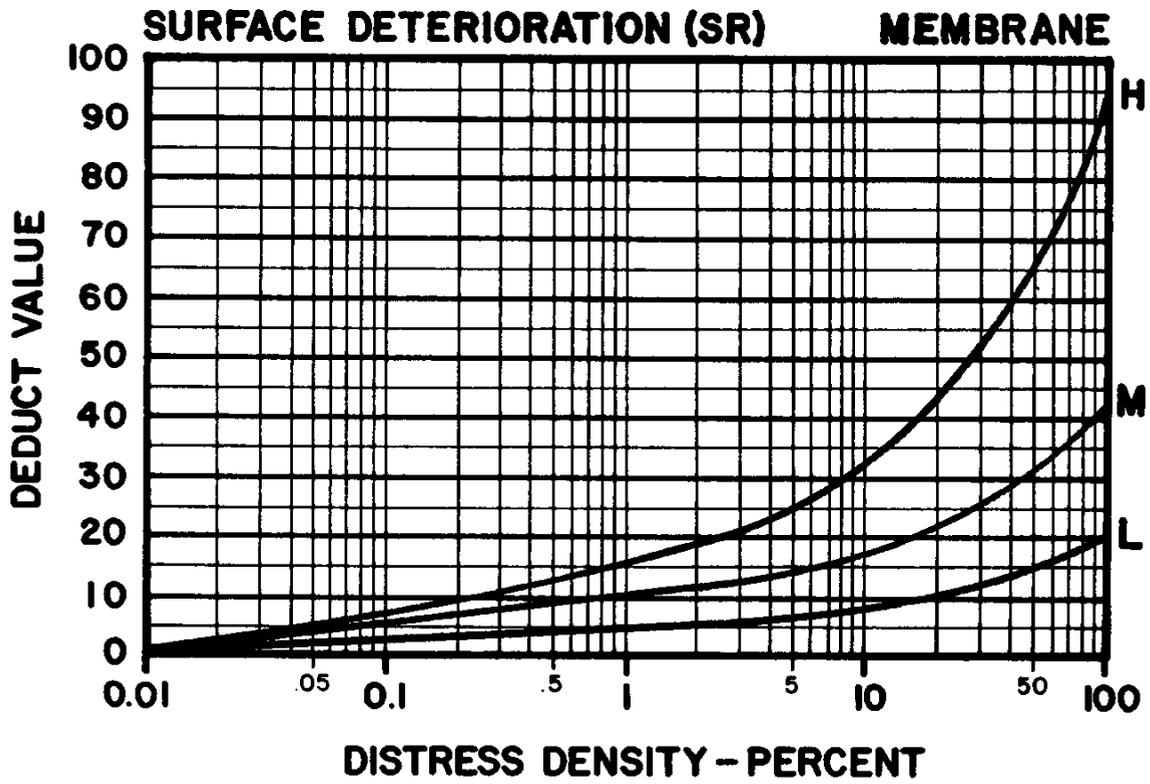

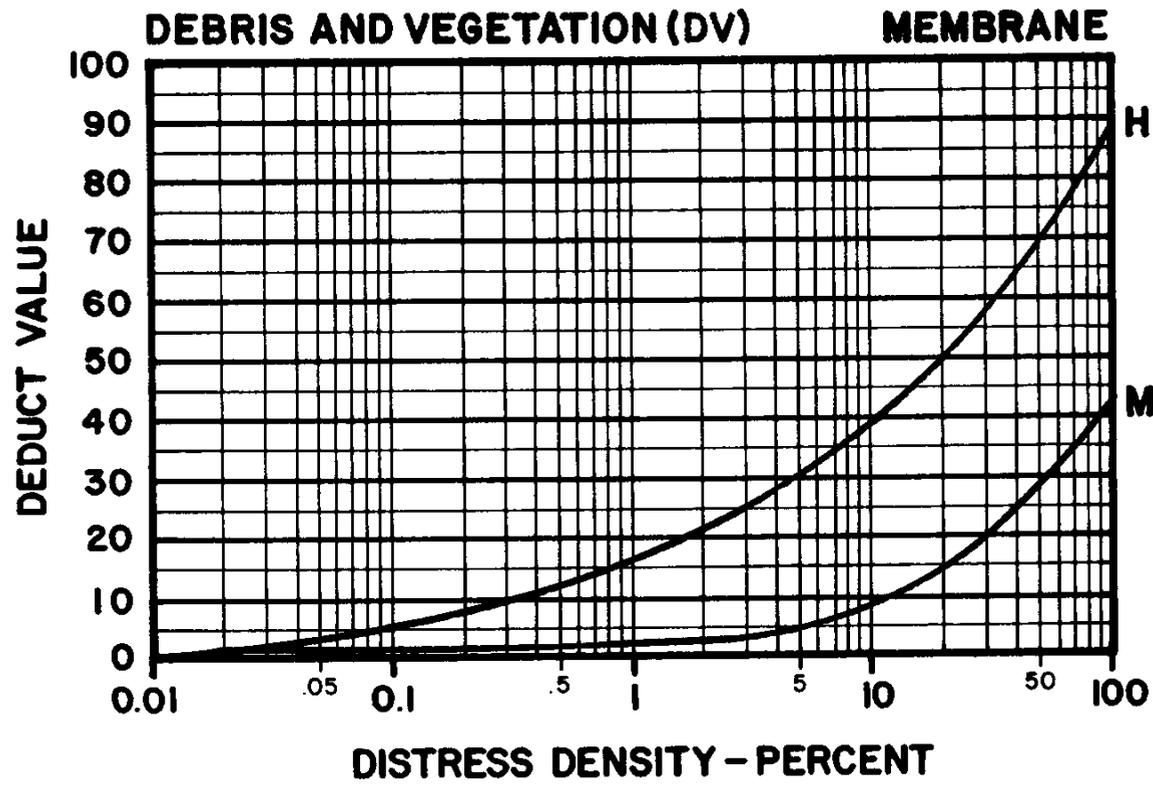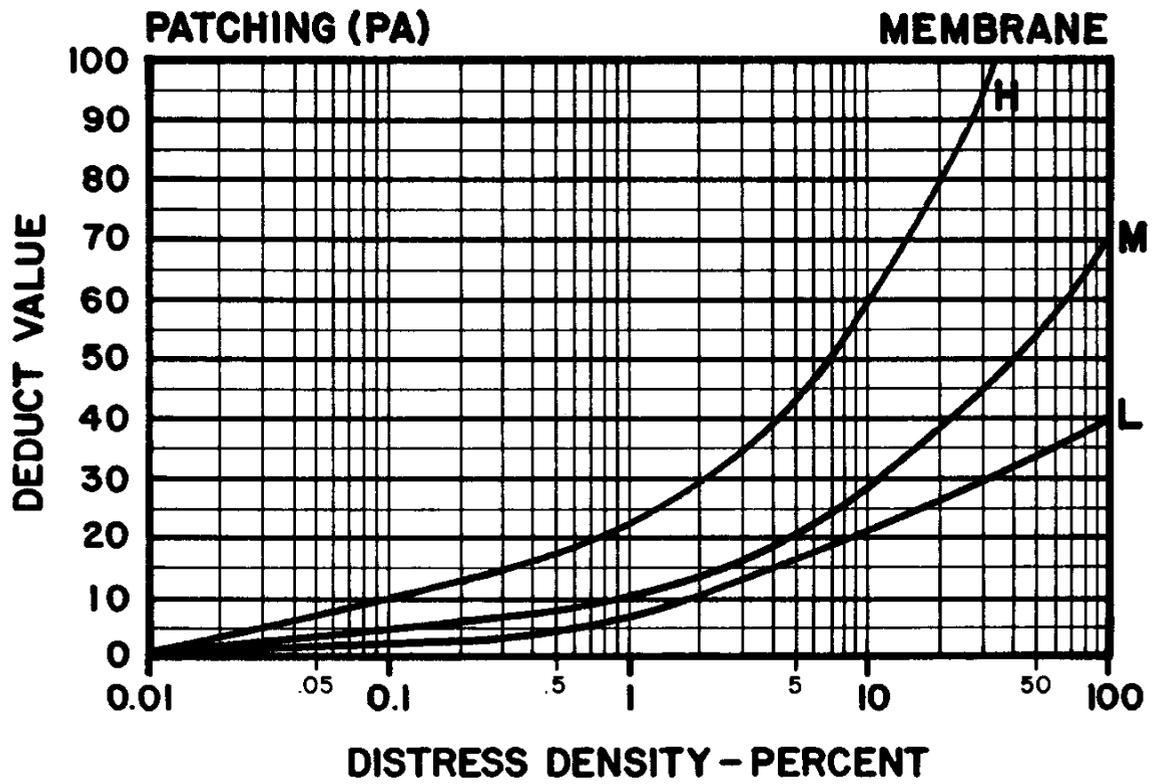

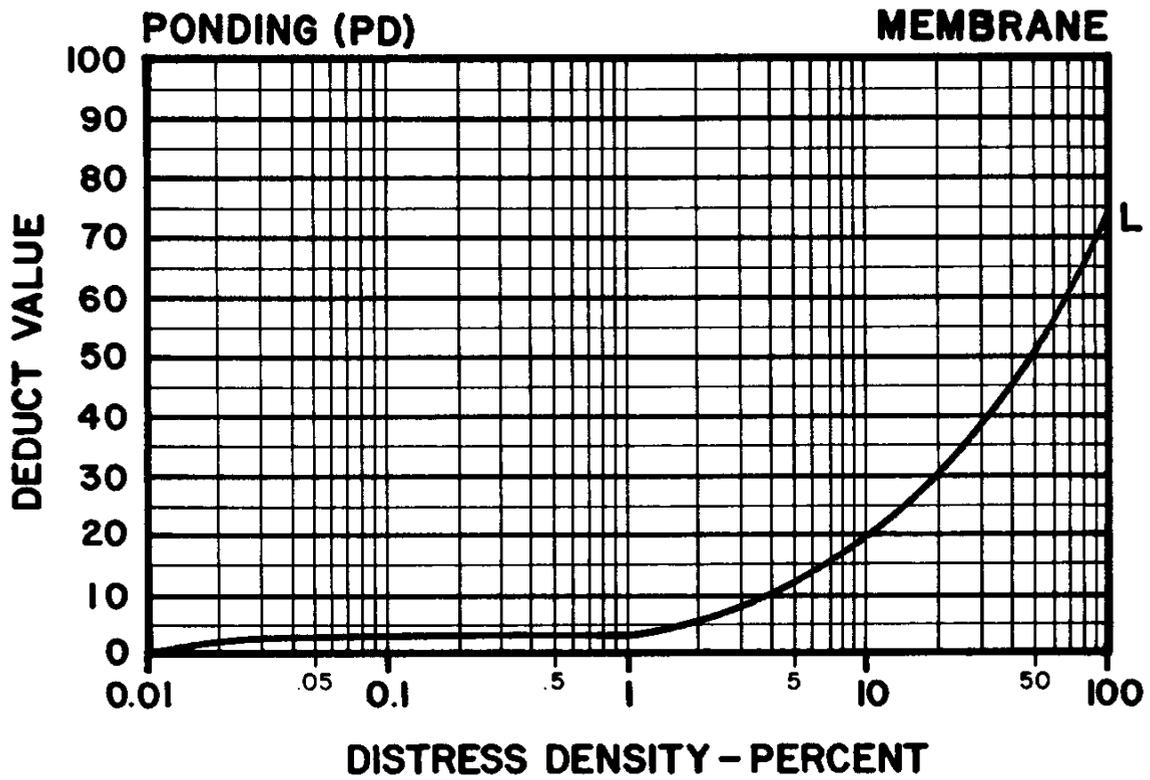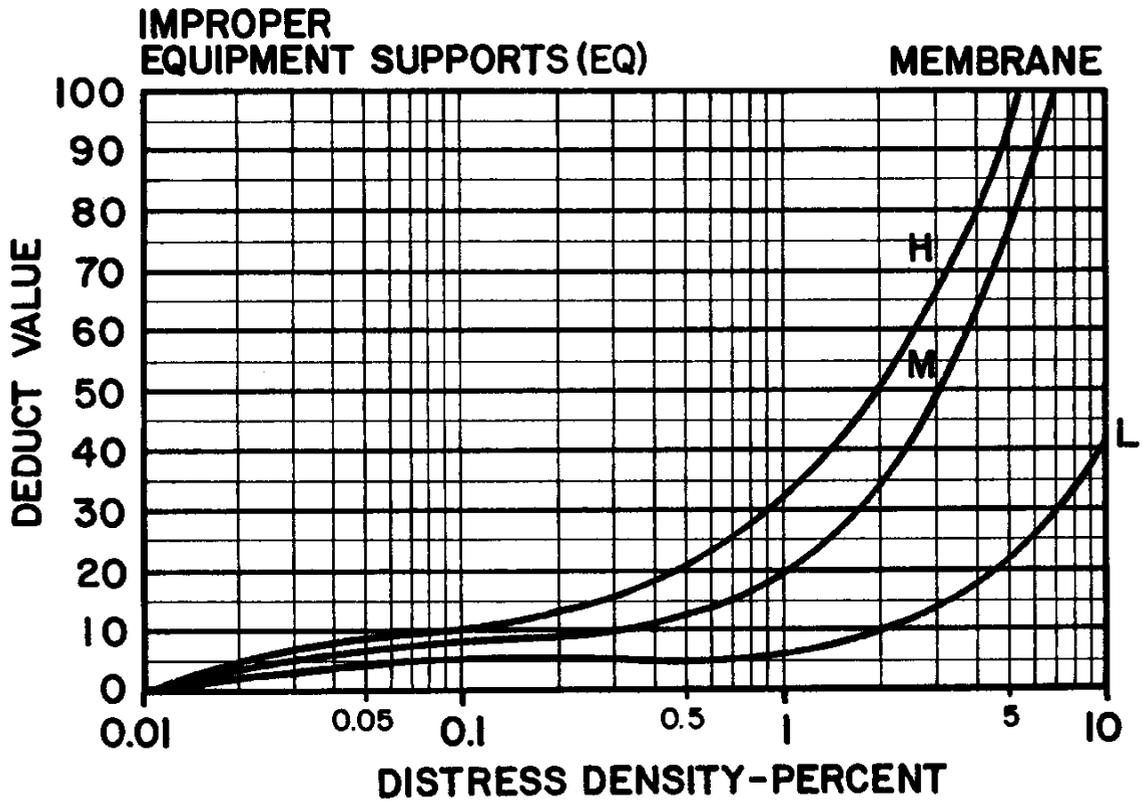

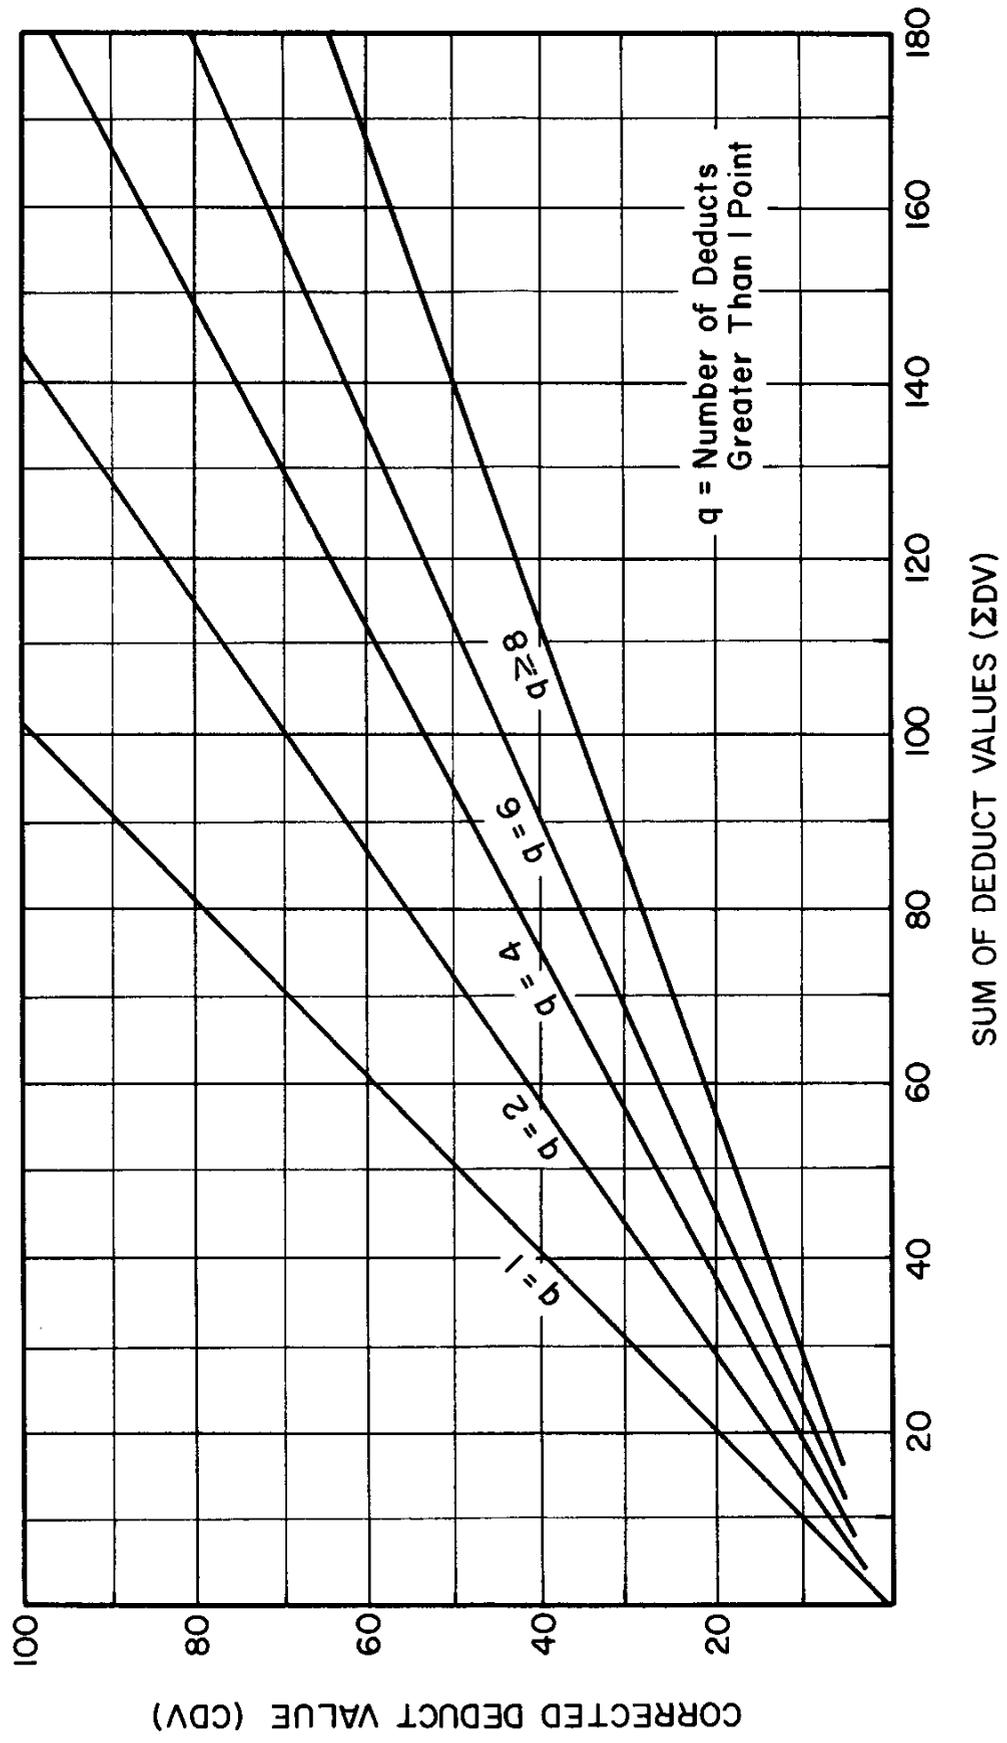

Corrected deduct values for membrane.

**APPENDIX B:**

**INSPECTION AND RATING FORMS**

On the following pages are a Roof Inspection Worksheet (front and back) and a Roof Section Rating Form that may be photocopied for use.



**REMARKS:**



# USA-CERL DISTRIBUTION

Chief of Engineers  
 ATTN: Tech Monitor  
 ATTN: CEIM-SL (2)  
 ATTN: CECC-P  
 ATTN: CECW  
 ATTN: CECW-0  
 ATTN: CECW-P  
 ATTN: CEEC  
 ATTN: CEEC-C  
 ATTN: CEEC-E  
 ATTN: CERD  
 ATTN: CERD-C  
 ATTN: CERD-M  
 ATTN: CERM  
 ATTN: DAEN-ZCE  
 ATTN: DAEN-ZCF  
 ATTN: DAEN-ZCI  
 ATTN: DAEN-ZCM  
 ATTN: DAEN-ZCZ

FESA, ATTN: Library 22060  
 ATTN: DET III 79906

US Army Engineer Districts  
 ATTN: Library (41)

US Army Engineer Divisions  
 ATTN: Library (14)

US Army Europe  
 AEAEN-ODCS/Engr 09403  
 ISAE 09081  
 V Corps  
 ATTN: DEH (11)  
 VII Corps  
 ATTN: DEH (15)  
 21st Support Command  
 ATTN: DEH (12)  
 USA Berlin  
 ATTN: DEH (11)  
 USASETAF  
 ATTN: DEH (10)  
 Allied Command Europe (ACE)  
 ATTN: DEH (3)

8th USA, Korea (19)

ROK/US Combined Forces Command 96301  
 ATTN: EUSA-HHC-CFC/Engr

USA Japan (USARJ)  
 ATTN: AJEN-DEH 96343  
 ATTN: DEH-Honshu 96343  
 ATTN: DEH-Okinawa 96331

416th Engineer Command 60623  
 ATTN: Facilities Engineer

US Military Academy 10966  
 ATTN: Facilities Engineer  
 ATTN: Dept of Geography &  
 Computer Science  
 ATTN: DSCPER/MAEN-A

AMMRC, ATTN DRXMR-WE 02172

USA AMCCOM 61299-6000  
 ATTN: AMSMC-RI  
 ATTN: AMSMC-IS

AMC - Dir., Inst., & Servc  
 ATTN: DEH (23)  
 ATTN: AMCEN-A

DLA ATTN: DLA-WI 22314

DNA ATTN: NADS 20305

FORSCOM  
 FORSCOM Engr, ATTN: AFEN-DEH  
 ATTN: DEH (23)

HSC  
 ATTN: HSLO-F 78234  
 ATTN: Facilities Engineer  
 Fitzsimons AMC 80240  
 Walter Reed AMC 20012

TRADOC  
 HQ, TRADOC, ATTN: ATEN-DEH  
 ATTN: DEH (19)

TSARCOM, ATTN: STSAS-F 63120

USACC, ATTN: Facilities Engr (2)

WESTCOM  
 ATTN: DEH, Ft. Shafter 96858  
 ATTN: APEN-IM

SHAPE 09055  
 ATTN: Surv. Section, CCB-OPS  
 Infrastructure Branch, LANDA

HQ USEUCOM 09128  
 ATTN: ECJ 4/7-LOE

FORT BELVOIR, VA 22060 (7)  
 ATTN: Canadian Liaison Officer  
 ATTN: British Liaison Officer  
 ATTN: Australian Liaison Officer  
 ATTN: French Liaison Officer  
 ATTN: German Liaison Officer  
 ATTN: Water Resources Support Ctr  
 ATTN: Engr Studies Center  
 ATTN: Engr Topographic Lab.  
 ATTN: ATZA-DTE-SU  
 ATTN: ATZA-DTE-EM  
 ATTN: R&D Command

CRREL, ATTN: Library 03755

WES, ATTN: Library 39180

HQ, XVIII Airborne Corps  
 and Fort Bragg  
 ATTN: AFZA-FE-EE 28307

Area Engineer, AEDC-Area Office  
 Arnold Air Force Station, TN 37389

Chanute AFB, IL 61868  
 3345 CES/DE, Stop 27

Norton AFB, CA 92409  
 ATTN: AFRCE-MX/DEE

AFESC, Tyndall AFB, FL 32403

NAVFAC  
 ATTN: Engineering Command (7)  
 ATTN: Division Offices (6)  
 ATTN: Naval Public Works Center (9)  
 ATTN: Naval Civil Engr Lab. (3)

NCEL  
 ATTN: Library, Code L08A 93043

Defense Technical Info. Center 22314  
 ATTN: DDA (2)

SETAF Engineer Design Office 09019

Engr Societies Library, NY 10017

Natl Guard Bureau Instl. Div 20310

US Govt Print Office 22304  
 Receiving Sect/Depository Copies (2)

US Army Env. Hygiene Agency  
 ATTN: HSHB-E 21010

National Bureau of Standards 20899

310  
06/87

EMC Team Distribution

Chief of Engineers 20314  
ATTN: DAEN-ZCF-B  
ATTN: DAEN-ECZ-A  
ATTN: DAEN-ECB (2)  
ATTN: DAEN-ZCP

US Army Engineer District  
New York 10007

ATTN: Chief, Design Br  
Pittsburgh 15222  
ATTN: Chief, ORPCD  
ATTN: Chief, Engr Div  
Philadelphia 19106  
ATTN: Chief, NAPEN-D  
Baltimore 21203  
ATTN: Chief, Engr Div  
Norfolk 23510

ATTN: Chief, NAOEN-M  
ATTN: Chief, NAOEN-D  
Huntington 25721

ATTN: Chief, ORHED-F  
Wilmington 28401  
ATTN: Chief, SAWCO-C  
ATTN: Chief, SAWEN-D  
Charleston 29402

ATTN: Chief, Engr Div  
Savannah 31402  
ATTN: Chief, SASAS-L  
Jacksonville 32232  
ATTN: Const Div  
Mobile 36628

ATTN: Chief, SAMEN-D  
ATTN: Chief, SAMEN-F  
ATTN: Chief, SAMEN  
Nashville 37202  
ATTN: Chief, ORNED-F  
Memphis 38103

ATTN: Chief, Const Div  
ATTN: Chief, LMMED-D  
Vicksburg 39180  
ATTN: Chief, Engr Div  
Louisville 40201

ATTN: Chief, Engr Div  
Detroit 48231  
ATTN: Chief, NCEED-T  
St. Paul 55101

ATTN: Chief, ED-D  
ATTN: Chief, ED-F  
Rock Island 61201  
ATTN: Chief, NCRED-F  
St. Louis 63101

ATTN: Chief, ED-D  
Kansas City 64106  
ATTN: Chief, Engr Div  
Omaha 68102

ATTN: Chief, Engr Div  
New Orleans 70160  
ATTN: Chief, LMNED-DG  
Little Rock 42203  
ATTN: Chief, Engr Div  
Tulsa 74102

ATTN: Chief, Engr Div  
Ft. Worth 76102  
ATTN: Chief, SWFED-D  
Galveston 77550

ATTN: Chief, SWGAS-L  
ATTN: Chief, SWGCO-C  
ATTN: Chief, SWGED-DC  
Albuquerque 87103  
ATTN: Chief, Engr Div  
Los Angeles 90053

ATTN: Chief, SPLED-F  
San Francisco 94105  
ATTN: Chief, Engr Div  
Sacramento 95814

ATTN: Chief, SPKED-D  
ATTN: Chief, SPKCO-C  
Far East 96301  
ATTN: Chief, Engr Div  
Portland 97208

ATTN: Chief, DB-6  
ATTN: Chief, FM-1  
ATTN: Chief, FM-2

Seattle 98124  
ATTN: Chief, NPSCO  
ATTN: Chief, NPSEN-FM  
ATTN: Chief, EN-DB-ST  
Walla Walla 99362  
ATTN: Chief, Engr Div  
Alaska 99501  
ATTN: Chief, NPASA-R

US Army Engineer Division  
New England 02154  
ATTN: Chief, NEDED-T  
ATTN: Laboratory  
ATTN: Chief, NEDCD  
Middle East (Rear) 22601  
ATTN: Chief, MEDED-T

North Atlantic 10007  
ATTN: Chief, NADEN  
South Atlantic 30303

ATTN: Laboratory  
ATTN: Chief, SADEN-TC  
ATTN: Chief, SADEN-TS

Huntsville 35807  
ATTN: Chief, HNDED-CS  
ATTN: Chief, HNDED-M  
ATTN: Chief, HNDED-SR

Lower Mississippi 39180  
ATTN: Chief, LMVED-G  
Ohio River 45201

ATTN: Laboratory  
ATTN: Chief, Engr Div  
Missouri River 68101

ATTN: Chief, MRDED-G  
ATTN: Laboratory  
Southwestern 75202

ATTN: Laboratory  
ATTN: Chief, SWDED-MA  
ATTN: Chief, SWDED-TG  
South Pacific 94111

ATTN: Laboratory  
Pacific Ocean 96858  
ATTN: Chief, Engr Div

ATTN: FM&S Branch  
ATTN: Chief, PODED-D  
North Pacific 97208

ATTN: Laboratory  
ATTN: Chief, Engr Div

6th US Army 94129  
ATTN: AFKC-EN

7th US Army 09407  
ATTN: AETTM-HRD-EHD

HQ, Combined Field Army (ROK/US) 96358  
ATTN: CFAR-EN

US Army Foreign Science and  
Tech Center  
ATTN: Charlottesville, VA 22901  
ATTN: Far East Office 96328

USA ARRADCOM 07801  
ATTN: DRDAR-LCA-OK

HQ, USAMRDC  
ATTN: SGRD-PLC  
Fort Detrick, MD 21701

West Point, NY 10996  
ATTN: Dept of Mechanics  
ATTN: Library

Ft. Belvoir, VA 22060  
ATTN: Learning Resource Center

Ft. Benning, GA 31905  
ATTN: ATZB-FE-EP  
ATTN: ATZB-FE-BG

Ft. Leavenworth, KS 66027  
ATTN: ATZLCA-SA

Ft. Lee, VA 23801  
ATTN: DRXMC-D (2)

Ft. McPherson, GA 30330  
ATTN: AFEN-CD

Ft. Monroe, VA 23651  
ATTN: ATEN-AD (3)  
ATTN: ATEN-FE-ME  
ATTN: ATEN-FE-BG (2)

Ft. Richardson, AK 99505  
ATTN: AFZT-FE-E

Rocky Mountain Arsenal 80022  
ATTN: SARRM-CO-FEP

USA-WES 39180  
ATTN: C/Structures  
ATTN: Soils & Pavements Lab

Naval Facilities Engr Command 22332  
ATTN: CODE 2013 C

COMMANDER (CODE 2636) 93555  
Naval Weapons Center

Little Rock AFB  
ATTN: 314/DEEE

Bldg. Research Advisory Board 20418

Dept of Transportation Library 20590  
Transportation Research Board 20418

112  
+1  
3/87

Tyndall AFB 32403  
ATTN: HQ AFESC/DEMM (3)

FESA 22060  
ATTN: CEFES-EB (3)

CRREL 07355  
ATTN: CECRL-EC (3)

NAVFACENCOM 19112  
ATTN: Code 102A (750)