



No provision in contract to grind sharp edges or remove laminar corrosion. Most of these surface problems were above the waterline.



2001 Top compartment on end of gate. After the second coat bare areas were common on the shaded side of rivets and plates.



2001 Runs indicate poor spray gun handling.



2001 Area in crevice is bare. Color difference indicates the mid-coat and topcoat have been applied.



2001 Rain after the mid-coat resulted in rust around attachments.



2001 Contract did not require the grinding of surface irregularities.